



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

400 Seventh Street, S.W.  
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

\*\*\*    \*\*\*    \*\*\*



AUTO SAFETY HOTLINE  
(800) 424-9393  
Wash. D.C. Area 366-0123

Case Vehicle (A): 1999 Ford  
 Type: Ranger XL 4 x 4, 2-door pickup  
 Driver: 27-year-old male  
 CDC: 12-FYEW-2

## **SITUATION**

(Slide 1) It was daytime, the sky was clear, and the roads were dry when case vehicle (A) was traveling north at an unknown speed on a two-lane asphalt road. (Slide 2) Case vehicle (A) made a right turn onto a two-lane gravel road, but was traveling too fast for the road surface conditions. (Slide 3) The driver of case vehicle (A) lost control of the vehicle and it exited the south edge of the road surface and (slide 4) struck a 90-cm diameter tree with its left front. The driver and right-front passenger were transported by ambulance to a local hospital and were treated and released. Case vehicle (A) was towed due to damage.

## **GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES**

(Slide 5) Damage to case vehicle (A) was moderate. (Slide 6) Direct damage began at the left bumper corner and extended 57 cm to the right, resulting in 40-percent vehicle overlap. (Slide 7) The maximum crush was 44 cm to the left upper radiator support.

Using the WinSMASH accident-reconstruction program and (slides 8, 9, 10 and 11) a crush profile measured at the front of case vehicle (A), the following impact severity was calculated:

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	37 (23)	-37 (-23)	-0 (-0)

## **DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)**

(Slide 12) Prior to inspection, the front bumper, the hood, the hood latch, and both front fenders were removed from the vehicle by a body shop for repair estimates.

### **Exterior**

In the front, (slides 13 and 14) the left portion of the bumper, the grille, the hood, and the engine compartment were crushed. Both hood hinges were damaged. (Slide 15) The rear edge of the

hood was elevated, but it did not contact the windshield, (slide 16) which was cracked due to occupant contact.

(Slide 17) The left fender was crushed, but there was no significant change in the left wheelbase.

(Slides 18 and 19) The right fender was deformed, but there was no significant change in the right wheelbase.

(Slide 20) There was no damage to the rear of the vehicle.

### **Interior**

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags. (Slide 21) The steering-wheel airbag deployed, (slide 22) but the passenger airbag did not deploy because it was turned off at the switch. (Slides 23, 24, 25, 26 and 27) There was no damage to the flaps/covers of the steering-wheel or passenger airbag modules. (Slides 28 and 29) The upper half of the steering-wheel rim was deformed slightly forward. (Slide 30) There was no damage to the spokes. There was no apparent displacement of the steering column. (Slide 31) The rear-view mirror was cracked and knocked off of its mount. The upper-center portion of the windshield was starred from contact by the rear-view mirror and/or the right-front passenger. (Slide 32) The upper-left portion of the windshield was starred from contact by an interior loose object and/or driver contact. (Slide 33) The glove box area was deformed. (Slide 34) The plastic right lower A-pillar/kickpanel cover was broken and knocked off. (Slide 35) The left-rear jumpseat was knocked loose from its mounts. (Slides 36, 37, 38 and 39) There was no other interior damage and there were no intrusions.

### **OCCUPANT KINEMATICS AND INJURIES**

(Slide 40) The 5-ft, 9-in, 160-lb, 27-year-old male driver was not wearing the three-point belt, (slide 41) but the frontal-impact airbag deployed. (Slides 42) There were no witness marks on the plastic D-ring. The driver seat was in the rear seat-track position.

During the frontal impact, the driver moved forward into the airbag. There was (slide 43) airbag powder on the steering-wheel rim, (slide 44) just above the left or eleven o'clock vent. The driver sustained a first-degree burn to the palmar aspect of the left hand, probably from the hot

airbag gases. He sustained a sprain and contusion to his right knee probably due to contact with the knee bolster, (slides 45 and 46) as evidenced by the scuff marks on the plastic knee bolster cover. (Slide 47) There was a black scuff mark on the right edge of the left knee bolster, and (slide 48) the windshield was starred just to the left of the steering wheel, but no injuries were associated with these witness marks.

(Slide 49) The 5-ft, 9-in, 170-lb, 21-year-old male, right-front passenger was not wearing the three-point belt, and the frontal-impact airbag did not deploy because it was turned off at the switch. (Slides 50) There were no witness marks on the plastic D-ring. The right-front passenger seat was in the full-rear seat-track position.

During the frontal impact, the right-front passenger moved forward into the instrument panel and windshield. He sustained a contusion to the right side of his forehead, probably due to contact with the windshield and/or rear-view mirror, (slides 51 and 52) as evidenced by the starred windshield, skin oil on the windshield, and (slide 53) the cracked rear-view mirror glass. He sustained a contusion to his right knee due to contact with the knee bolster/glove box, (slides 54) as evidenced by an indentation into the plastic knee bolster cover.

The following tables and attached drawings (slides 55 and 56) summarize the injuries sustained by the two occupants of case vehicle (A).

Occupant: Driver  
 Restraints: 3-point belt not worn; frontal-impact  
 airbag deployed

Age: 27 years  
 Stature: 175 cm (5 ft, 9 in)

Gender: Male  
 Mass: 73 kg (160 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
First degree burn, palmar aspect of the left hand	1		Airbag gas	
Sprain, right knee	2		Knee bolster	
Contusion, right knee	1		Knee bolster	
<u>Maximum A.I.S. Level</u>	<u>2</u>			
<u>Injury Severity Score</u>	<u>5</u>			

Occupant: Right front

Restraints: 3-point belt not worn; frontal-impact airbag did not deploy (turned off at switch)

Age: 21 years

Stature: 175 cm (5 ft, 9 in)

Gender: Male

Mass: 77 kg (170 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Contusion, right side of forehead	1		Windshield/ rear-view mirror	
Contusion, right knee	1		Knee bolster/glove box	
<u>Maximum A.I.S. Level</u>	<u>1</u>			
<u>Injury Severity Score</u>	<u>1</u>			

Duplicate columns 1-8  
from the previous card.

Module G 1 Format 0 2  
9 10 11 12

# GENERAL INFORMATION GI-1

## TIME

DATE OF COLLISION

      /       /            

HOUR OF COLLISION

(24 HOUR CLOCK)

21

24

## LOCATION

STATE:                     

STATE FIPS CODE

25 26

AREA

- (1) URBAN
- (2) RURAL
- (9) UNKNOWN

2  
27

## ENVIRONMENTAL CONDITIONS

LIMITED-ACCESS HIGHWAY

- (0) NO
- (1) YES
- (9) UNKNOWN

0  
28

ROAD, TOTAL TRAFFIC LANES  
(FOR CASE VEHICLE)

- (1) 1-LANE
- (2) 2-LANES
- (3) 3-LANES
- (4) 4 OR MORE LANES
- (5) DIVIDED, 4 OR MORE LANES
- (6) PARKING LOT/DRIVEWAY
- (7) OTHER:
- (9) UNKNOWN

2  
29

INTERSECTING RD, TOTAL LANES

CHOOSE FROM ABOVE LIST, OR

- (8) NOT APPLICABLE

2  
30

TYPE OF ROAD SURFACE

- (1) ASPHALT
- (2) CONCRETE
- (3) GRAVEL
- (4) MORE THAN ONE (CIRCLE EACH)
- (7) OTHER:
- (9) UNKNOWN

3  
31

ROAD DEFECTS

- (0) NO
- (1) YES
- (9) UNKNOWN

0  
32

## ENVIRONMENTAL CONDITIONS

CONSTRUCTION ZONE

- (0) NO
- (1) YES
- (9) UNKNOWN

0  
33

ROAD ALIGNMENT  
VERTICAL PLANE

- (1) LEVEL
- (2) CREST OF HILL
- (3) SLOPE (2%)
- (4) BOTTOM OF HILL
- (9) UNKNOWN

1  
34

ROAD ALIGNMENT  
HORIZONTAL PLANE

- (1) STRAIGHT
- (2) CURVE
- (3) T - SHAPED
- (4) Y - SHAPED
- (7) OTHER:
- (9) UNKNOWN

1  
35

SURFACE COVERING

- (10) DRY

10  
36 37

- (21) WATER - DAMP
- (22) WATER - WET
- (23) WATER - PUDDLED
- (29) WATER - AMOUNT UNKNOWN

- (31) SNOW - LOOSE
- (32) SNOW - PACKED
- (39) SNOW - CONDITION UNKNOWN

- (41) ICE
- (51) SLUSH
- (61) SPILLED GRAVEL
- (71) OTHER:
- (99) UNKNOWN

VISIBILITY LIMITATION  
(FOR CASE VEHICLE)

- (0) NONE
- (1) CLOUDY/DARK
- (2) FOG
- (3) SMOKE
- (4) WINDSHIELD CONDITION
- (5) GLARE
- (6) RAIN
- (7) OTHER:
- (8) ICE/SNOW
- (9) UNKNOWN

0  
38

VISIBILITY OBSTRUCTION  
(FOR CASE VEHICLE)

- (0) NONE
- (1) BUILDING
- (2) SIGN
- (3) VEGETATION (E.G. BUSHES, SHRUBS)
- (4) TREE
- (5) HILL OR CURVE IN ROAD
- (6) VEHICLE IN TRANSPORT
- (7) OTHER:
- (8) PARKED VEHICLE
- (9) UNKNOWN

0  
39

## ENVIRONMENTAL CONDITIONS

## SPEED LIMIT

- (0) 5-45 km/h ..... 5-25 mph  
 (1) 46-55 ..... 30  
 (2) 56-60 ..... 35  
 (3) 61-70 ..... 40  
 (4) 71-79 ..... 45  
 (5) 80-85 ..... 50  
 (6) 86-90 ..... 55  
 (7) 91-105 ..... 60  
 (8) OVER 105 ..... 65  
 (9) UNKNOWN

## PRECIPITATION

- (0) NONE  
 (1) RAIN  
 (2) SNOW  
 (3) HAIL  
 (4) FREEZING RAIN/SLEET  
 (7) OTHER: \_\_\_\_\_  
 (9) UNKNOWN

## RATE OF PRECIPITATION

- (1) LIGHT/MIST  
 (2) MODERATE  
 (3) HEAVY  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

## TEMPERATURE

- (0) BELOW -15° C ..... BELOW 5° F  
 (1) -15 TO -6 ..... 5 TO 22  
 (2) -5 TO -1 ..... 23 TO 31  
 (3) 0 TO 2 ..... 32 TO 36  
 (4) 3 TO 5 ..... 37 TO 41  
 (5) 6 TO 15 ..... 42 TO 59  
 (6) 16 TO 25 ..... 60 TO 77  
 (7) 26 TO 35 ..... 78 TO 95  
 (8) OVER 35 ..... OVER 96  
 (9) UNKNOWN

## CROSSWIND

- (0) NONE  
 (1) LIGHT  
 (2) STRONG  
 (3) GUSTY & STRONG  
 (9) UNKNOWN

## LIGHT CONDITIONS

- (1) DAYLIGHT  
 (2) DAWN  
 (3) DUSK  
 (4) DARK, LIGHTED  
 (5) DARK, UNLIGHTED  
 (6) DARK, UNKNOWN IF LIGHTED  
 (9) UNKNOWN

## MECHANICAL MALFUNCTION

WAS THERE MENTION  
OF A MECHANICAL MALFUNCTION  
IN CASE VEHICLE

- (0) NO  
 (1) YES  
 (2) YES, DID NOT CONTRIBUTE  
TO ACCIDENT  
 (9) UNKNOWN

THE FOLLOWING SECTION SHOULD BE FILLED  
OUT IF A MECHANICAL MALFUNCTION IS  
RECOGNIZED OR SUSPECTED.

CIRCLE ITEMS INVOLVED. SUPPORT ANY  
ITEMS CIRCLED WITH COMMENTS.

BRAKE SYSTEM	DRIVER CONTROLS
EXHAUST SYSTEM	POWER TRAIN
STEERING SYSTEM	FUEL SYSTEM
SUSPENSION SYSTEM	VISIBILITY ITEMS
ELECTRICAL SYSTEM	TIRES
THROTTLE CONTROLS	UNKNOWN

OTHER: \_\_\_\_\_

COMMENTS: \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_



## CRASH DETAILS

## CASE VEHICLE AND OBJECT

- (0) NO  
(1) YES  
(9) UNKNOWN

1

47

## CASE VEHICLE ROLLOVER

- (0) NO ROLLOVER  
(1) YES, FIRST EVENT  
(2) YES, SUBSEQUENT EVENT  
(3) YES, SEQUENCE UNKNOWN  
(9) UNKNOWN

0

48

CASE VEHICLE RAN OFF ROADWAY  
(BEFORE FIRST IMPACT)

- (0) NO  
(1) YES  
(9) UNKNOWN

1

49

MOVING CASE VEHICLE AND  
CONTACTED MOVING VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

0

50

CASE VEHICLE AND  
CONTACTED STOPPED VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

0

51

STOPPED CASE VEHICLE AND  
CONTACTED VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

0

52

TOTAL NUMBER  
OF VEHICLES CONTACTED  
BY CASE VEHICLE IN CRASH

- (8) 8 OR MORE  
(9) UNKNOWN

0

53

ANY FIRE IN THIS CRASH  
(NOT JUST CASE VEHICLE)

- (0) NO  
(1) YES  
(9) UNKNOWN

0

54

HIGHEST POLICE INJURY  
SEVERITY CODE IN CRASH  
(NOT JUST CASE VEHICLE)

- (0) O - NO INJURY  
(1) C - POSSIBLE INJURY  
(2) B - NON-INCAPACITATING INJURY  
(3) A - INCAPACITATING INJURY  
(4) K - FATAL  
(5) INJURED, SEVERITY UNKNOWN  
(6) DIED PRIOR TO ACCIDENT  
(7) NON-FATAL INJURY  
SEVERITY UNKNOWN  
(9) UNKNOWN

2

55

## DRIVER IMPAIRMENT

DRIVER ALCOHOL INVOLVEMENT  
(CASE VEHICLE)

- (0) NONE  
(1) YES  
(9) UNKNOWN/NOT REPORTED/  
NO DRIVER

0

56

DRIVER ALCOHOL BAC  
(CASE VEHICLE)

- (80) NO TEST  
(90) CHEMICAL TESTS, NO RESULTS  
(95) AUTOPSY, NO RESULTS  
(99) UNKNOWN

80

57

58

WAS THERE MENTION OF DRIVER  
IMPAIRMENT FOR CASE VEHICLE?

- (0) NO  
(1) YES  
(9) UNKNOWN

0

59

## LIST IMPAIRMENTS MENTIONED:

---



---



---

## Post - CRASH DETAIL

MANNER CASE VEHICLE  
LEFT SCENE

- (1) DRIVEN  
(2) TOWED DUE TO DAMAGE  
(3) TOWED, NOT DUE TO DAMAGE  
(4) TOWED, REASON UNKNOWN  
(9) UNKNOWN

2

60

# ACCIDENT SCHEMATIC

ACCIDENT DESCRIPTION: Case vehicle (A) was traveling north and made a right turn onto a gravel road. The driver lost control of case vehicle (A) and the vehicle exited the road and struck a tree with its left-front.


CASE VEHICLE (A): 1999 Ford Ranger PU

OTHER VEHICLE (B): \_\_\_\_\_

THIRD VEHICLE (C): \_\_\_\_\_



NORTH

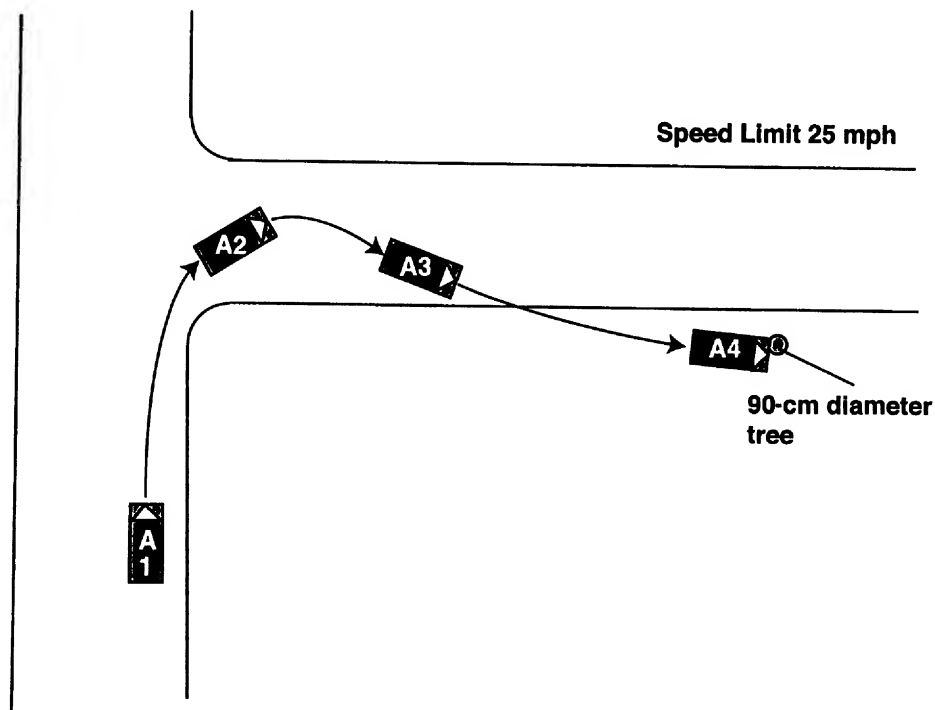

Duplicate columns 1-8  
from the previous card.

Module O V Format 0 4  
9 10 11 12

OTHER VEHICLE OV-1

MAKE: \_\_\_\_\_  
MODEL: **NOT APPLICABLE**

CARGO: \_\_\_\_\_

VIN

13

29

MANUFAC/BODY CODE

30

34

MAKE/MODEL CODE

38

MODEL YEAR

39

42

VEHICLE MASS (kg)

43

48

IF SEPARATE REPORT WAS MADE,  
GIVE VEHICLE NUMBER

NUMBER OF OCCUPANTS  
(ENTER 9'S IF UNKNOWN)

51

TRAVELING SPEED (km/h)

54

- (000) PARKED OR STOPPED  
(995) JUST STARTING UP  
(996) BACKING UP  
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)  
(998) SPEED EXCESSIVE (BUT UNKNOWN)  
(999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY  
CODE FOR THIS VEHICLE

- (0) O - NO INJURY  
(1) C - POSSIBLE INJURY  
(2) B - NON-INCAPACITATING INJURY  
(3) A - INCAPACITATING INJURY  
(4) K - FATAL  
(5) INJURED, SEVERITY UNKNOWN  
(6) DIED PRIOR TO ACCIDENT  
(7) NON-FATAL INJURY  
SEVERITY UNKNOWN  
(8) UNOCCUPIED VEHICLE  
(NOT APPLICABLE)  
(9) UNKNOWN

55

### VEHICLE TYPE

#### PASSENGER VEHICLE

- (02) LARGE  
(03) LIMOUSINE  
(17) PICKUP CAR  
(20) UNKNOWN PASSENGER VEHICLE BODY  
(24) SUB-MINI  
(25) MINI  
(26) SUB-COMPACT  
(27) COMPACT  
(28) INTERMEDIATE  
(29) FULL

56

57

#### MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",  
E.G. JEEP, BRONCO)  
(15) LARGE UTILITY (WHEELBASE MORE THAN 107",  
E.G. PANEL TRUCK, SUBURBAN)  
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER  
(17) PICKUP CAR WITH CANOPY/SHELL COVER  
(21) MOTOR HOME  
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER  
(23) PICKUP CAR WITH SLIDE-IN CAMPER  
(31) CHASSIS-MOUNTED CAMPER

#### TRUCK

- (11) VAN  
(12) PICKUP TRUCK  
(13) UNKNOWN LIGHT TRUCK  
(15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)  
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER  
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER  
(30) UNKNOWN TRUCK TYPE  
(31) CHASSIS-MOUNTED CAMPER  
(33) DELIVERY VAN (WALK-IN)  
(34) STRAIGHT TRUCK  
(35) TRUCK-TRACTOR (BOBTAIL)  
(36) CHASSIS-CAB  
(37) UNKNOWN HEAVY TRUCK  
(38) TRACTOR & SEMI-TRAILER (SEMI)  
(39) TRUCK (OR SEMI) & FULL TRAILER(S)

#### BUS

- (40) UNKNOWN BUS TYPE  
(41) SCHOOL BUS  
(42) INTERCITY BUS (BETWEEN CITIES)  
(43) TRANSIT BUS (INTRACITY)  
(44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)  
(69) LOCOMOTIVE (ENGINE, SWITCHER)

- (99) UNKNOWN

WHEELBASE (cm)

- (999) UNKNOWN

58 59 60

Duplicate columns 1-8  
from the previous card.

Module 0 V Format 0 2  
9 10 11 12

OTHER VEHICLE OV-2

### ORIGINAL SPECIFICATIONS

Wheelbase	_____ cm	Front Overhang	_____ cm
			22 _____ 24
Curb Weight	_____ kg	Rear Overhang	_____ cm
			25 _____ 27
Average Track Width	_____ cm	Undeformed End Width (UEW)	_____ cm
	13 _____ 15		28 _____ 30
Overall Length	_____ cm	Engine Displacement	_____ L
	16 _____ 18		31 _____ 32
Overall Width (OAW)	_____ cm	Engine: # of Cylinders	_____
	19 _____ 21		33 _____ 34

### VEHICLE DAMAGE

NOT APPLICABLE

### FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more  
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) \_\_\_\_\_ cm  
35 \_\_\_\_\_ 37

Front-End Overlap (Percent) =  $\frac{DDL}{UEW}$  \_\_\_\_\_ %  
38 39

Vehicle Overlap (Percent) =  $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$  \_\_\_\_\_ %  
40 41

- Duplicate columns 1-8 from the previous card.

Module V D Format 0 4  
9 10 11 12

# VEHICLE DESCRIPTION VD-1

MAKE: Ford

CARGO: \_\_\_\_\_

MODEL: Ranger XL, 4x4

VIN 1 F T Z R 1 5 X 6 X T [REDACTED]

MANUFAC/BODY CODE 1 2 1 1 2  
30 34

MAKE/MODEL CODE 3 1 2 0  
38

MODEL YEAR 1 9 9 9  
39 42

VEHICLE MASS (kg) 0 0 1 6 1 5  
43 48

ODOMETER (km)  
(ENTER 9'S IF UNKNOWN) 0 4 7 7 8 3  
(ENTER 8'S IF ELECTRONIC) 49 54

NUMBER OF OCCUPANTS 0 2  
(ENTER 9'S IF UNKNOWN) 56

TRAVELING SPEED (km/h) 9 9 8  
59

- (000) PARKED OR STOPPED  
(995) JUST STARTING UP  
(996) BACKING UP  
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)  
(998) SPEED EXCESSIVE (BUT UNKNOWN)  
(999) UNKNOWN

## STOLEN VEHICLE

- (0) NO  
(1) YES  
(8) NOT COLLECTED  
(9) UNKNOWN

8  
62

## BODY STRUCTURE

- (1) BODY & FRAME  
(2) UNITIZED  
(3) INTEGRAL-STUB FRAME  
(4) BODY & PLATFORM FRAME  
(E.G. VW BUG)  
(5) PARTIALLY UNITIZED  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

1  
63

## TRANSMISSION

- (0) NONE  
(1) AUTOMATIC  
(2) MANUAL  
(9) UNKNOWN

1  
64

## LOCATION OF TRANSMISSION SELECTOR LEVER

- (1) FLOOR  
(2) CONSOLE  
(3) COLUMN  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

3  
65

## STEERING

- (1) POWER  
(2) MANUAL  
(9) UNKNOWN

1  
66

## BRAKES

- (1) POWER  
(2) MANUAL  
(9) UNKNOWN

1  
67

## VEHICLE TYPE

### PASSENGER VEHICLE

- (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR)  
(12) 2-DOOR SEDAN OR COUPE  
(ANY UPPER B-PILLAR)  
(13) 4-DOOR HARDTOP  
(14) 4-DOOR SEDAN  
(15) STATION WAGON  
(16) CONVERTIBLE  
(18) OTHER PASS. VEH.: \_\_\_\_\_  
(19) PASSENGER VEHICLE, TYPE UNKNOWN

3 2  
60 61

### MULTIPURPOSE PASSENGER VEHICLE

- (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO)  
(22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)  
(23) VAN, SIZE UNKNOWN  
(24) VAN, SMALL (MINI)  
(25) VAN, LARGE  
(29) MPV, TYPE UNKNOWN  
(30) MOTOR HOME

### TRUCK

- (31) PICKUP TRUCK, UNKNOWN  
(32) PICKUP TRUCK, SMALL (DOWNSIZED)  
(33) PICKUP TRUCK, LARGE

(99) UNKNOWN

TYPE OF BRAKES	2 68	WHEELBASE (cm) (999) Unknown	320 76 77 78
(1) DRUM, ALL WHEELS (2) DISC, FRONT WHEELS (3) DISC, ALL WHEELS (9) UNKNOWN			
BRAKE ANTI-LOCK DEVICE	1 69	PLASTIC ANTI-LACERATIVE INNER LAYER GLASS EQUIPPED	0 79
(0) NONE INSTALLED (1) TWO-WHEEL (2) FOUR-WHEEL (7) EQUIPPED, UNKNOWN WHEELS (9) UNKNOWN		(0) NONE (1) WINDSHIELD (2) WINDSHIELD AND SIDE (7) OTHER (9) UNKNOWN	
AIR CONDITIONING IN VEHICLE	8 70		
(0) NO (1) YES (8) NOT COLLECTED (9) UNKNOWN			
TYPE OF DRIVE	3 71	FIELD INVESTIGATOR INSTRUCTIONS:	
(1) REAR WHEEL (2) FRONT WHEEL (3) FOUR WHEEL (4) ALL WHEEL DRIVE (9) UNKNOWN		1. INDICATE CRUSHED AREAS BY <u>OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3.</u> USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.	
DUAL REAR WHEELS	0 72	2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE.	
(0) NO (1) YES (9) UNKNOWN		3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR.	
ORIGINAL TYPE OF RESTRAINT SYSTEM	3 73	4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.	
(1) ACTIVE BELT (2) PASSIVE BELT (3) AIRBAG (4) KNEE BOLSTERS (7) OTHER: _____ (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN		EXAMPLES:	
EQUIPPED WITH ROLL BAR	0 74	FRONT OR REAR	
(0) NO (1) YES (9) UNKNOWN			
TYPE OF ROOF	1 75	SIDE	
(0) NONE (1) SOLID (2) T-TOP CLOSED (3) T-TOP OPEN (4) SUN ROOF CLOSED (5) SUN ROOF OPEN (6) CONVERTIBLE CLOSED (7) CONVERTIBLE OPEN (8) OTHER: _____ (9) UNKNOWN		ROOF (REFERENCE TO TOP OF DOOR SILL OR WINDOW SILL)	

ORIGINAL SPECIFICATIONS

Wheelbase 320 cm

Front Overhang 085 cm  
22 24

Curb Weight 1615 kg

Rear Overhang 111 cm  
25 27

Average Track Width 147 cm  
13 15

Undeformed End Width (UEW) 150 cm  
28 30

Overall Length 515 cm  
16 18

Engine Displacement 4.0 L  
31 32


Overall Width (OAW) 179 cm  
19 21

Engine: # of Cylinders 06  
33 34

VEHICLE DAMAGE

MEASUREMENTS IN CENTIMETERS

Both front fenders, bumper and hood removed prior to inspection

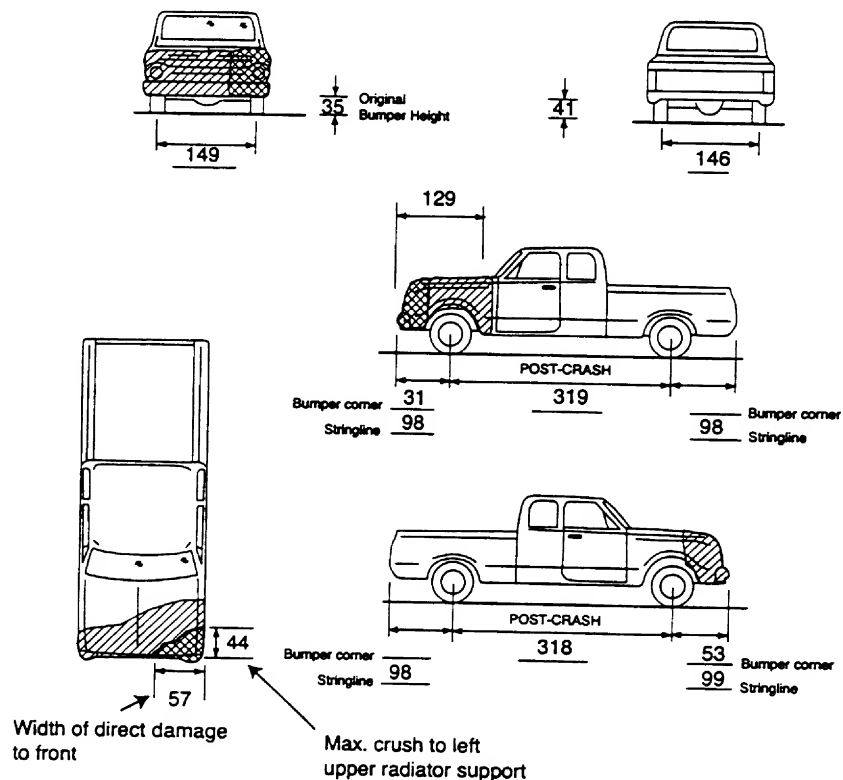

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more  
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 057 cm  
35 37

Front-End Overlap (Percent) =  $\frac{DDL}{UEW}$  38 %  
38 39

Vehicle Overlap (Percent) =  $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$  40 %  
40 41

Duplicate columns 1-8  
from the previous card.

Module D A Format 0 2  
9 10 11 12

DAMAGE DA-1

## PRIMARY

### CASE VEHICLE PRIMARY CDC

### CONTACTED VEHICLE ASSOCIATED CDC

EVENT NUMBER

1  
13

IMPACT SPEED (km/h)

999  
14 15 16

ESTIMATED BY

1  
17

CRUSH (cm)

044  
18 19 20

CDC #1

12.FYEW.2  
21 27

CDC #2

98.0000.0  
28 34

998  
35 36 37

8  
38

998  
39 40 41

98.0000.0  
42 48

98.0000.0  
49 55

Duplicate columns 1-8  
from the previous card.

Module D A Format 0 3  
9 10 11 12

## SECONDARY

### CASE VEHICLE SECONDARY CDC

### CONTACTED VEHICLE ASSOCIATED CDC

EVENT NUMBER

      
13

IMPACT SPEED (km/h)

                
14 15 16

ESTIMATED BY

      
17

CRUSH (cm)

                
18 19 20

CDC #1

                                         
21 27

CDC #2

                                         
28 34

                
35 36 37

      
38

                
39 40 41

                                         
42 48

                                         
49 55

## CODES

### EVENT NUMBER

(8) NOT APPLICABLE  
(9) UNKNOWN

### IMPACT SPEED

(998) NOT APPLICABLE  
(999) UNKNOWN

### IMPACT SPEED ESTIMATOR

(1) INVESTIGATOR  
(2) DRIVER  
(3) POLICE  
(4) "CRASH" PROGRAM  
(5) OTHER COMPUTER PROGRAM  
SPECIFY: \_\_\_\_\_  
(7) OTHER: \_\_\_\_\_  
(8) NOT APPLICABLE  
(NO VEHICLE/NO IMPACT)

### CRUSH

(998) NOT APPLICABLE  
(NO VEHICLE/DAMAGE)  
(999) UNKNOWN

### CDC

(9800000) NOT APPLICABLE  
(9900000) UNKNOWN



## MAXIMUM SHEET METAL CRUSH

(cm) (999) UNKNOWN

FRONT      0   4   4  
              13        15

RIGHT SIDE      0   0   0  
                         16       18

REAR      0   0   0  
              19        21

LEFT SIDE      0   0   2  
                         22      24

ROOF      0   0   0  
              25        27

OTHER 28 30

### CHRONOLOGICAL SEQUENCE OF DAMAGE/INJURY PRODUCING CRASH EVENTS FOR CASE VEHICLE

**NOTE: IF CHRONOLOGICAL ORDER IS UNKNOWN, EVENT ORDER IS OPTIONAL.**

**DO YOU KNOW THIS TABLE  
TO BE IN CHRONOLOGICAL ORDER?**

(0) NO  
(1) YES

EVENT NUMBER	IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN	IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3.	OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4.
# 1	<u>4</u> 32	<u>17</u> 34	<u>77 tree</u> 36
#2	<u>      </u> 37	<u>      </u> 39	<u>      </u> 41
#3	<u>      </u> 42	<u>      </u> 44	<u>      </u> 46
#4	<u>      </u> 47	<u>      </u> 49	<u>      </u> 51
#5	<u>      </u> 52	<u>      </u> 54	<u>      </u> 56
#6	<u>      </u> 57	<u>      </u> 59	<u>      </u> 61
#7	<u>      </u> 62	<u>      </u> 64	<u>      </u> 66

# CODES FOR IMPACT CONFIGURATION

## FRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

## LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

## REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

## RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

## OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

## ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

## UNKNOWN

- (99) IMPACT TYPE UNKNOWN

# CODES FOR VEHICLE/OBJECT CONTACTED

## VEHICLE/OBJECT GROUPS

- (00) NO OBJECT
- (01) - (39) PASSENGER VEHICLE & TRUCK
- (40) - (69) OTHER VEHICLE
- (70) - (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) - (97) OFF-ROADWAY OBJECT

- (98) OTHER (DESCRIBE)
- (99) UNKNOWN

## PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZE	WHEELBASE
SUB-MINI	< 2286 mm (< 90")
MINI	2286 - 2412 mm (90" - 94.9")
SUB-COMPACT	2413 - 2539 mm (95" - 99.9")
COMPACT	2540 - 2666 mm (100" - 104.9")
INTERMEDIATE	2667 - 2793 mm (105" - 109.9")
FULL	2794 - 2920 mm (110" - 114.9")
LARGE	2921 - 3174 mm (115" - 124.9")
LIMOUSINE	> 3175 mm (> 125")

## MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",  
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107",  
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

## TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

## BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

## MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 - 75 cc
- (52) 76 - 125 cc
- (53) 126 - 250 cc
- (54) 251 - 500 cc
- (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

## SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

## OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING  
ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM  
OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE  
MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION
- (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES



Duplicate columns 1-8  
from the previous card.

Module C R Format 0 1  
9 10 11 12

# CRASH RECONSTRUCTION CR-1

for  $\Delta V$

	CASE VEHICLE PRIMARY IMPACT			CASE VEHICLE SECONDARY IMPACT		
	CASE VEHICLE	CONTACTED VEHICLE		CASE VEHICLE	CONTACTED VEHICLE	
EVENT NUMBER	<u>1</u> 13	<u>Tree</u>		<u>47</u>		
$\Delta V$ (km/h) TOTAL	<u>037</u> 14 15 16	<u>8</u> 32 33 34		<u>48 49 50</u>	<u>66 67 68</u>	
LONGITUDINAL*	<u>-037</u> 17 20	<u>8</u> 35 38		<u>51 54</u>	<u>69 72</u>	
LATERAL*	<u>+000</u> 21 24	<u>8</u> 39 42		<u>55 58</u>	<u>73 76</u>	
*NOTE: THESE $\Delta V$ COMPONENTS MUST INCLUDE SIGN.						
EXAMPLES: 10 km/h = <u>+010</u> -7 km/h = <u>-007</u>						
ENERGY DISSIPATED BY CRUSH (kj)	<u>0104</u> 25 28	<u>8</u> 43 46		<u>59 62</u>	<u>77 80</u>	
RECONSTRUCTION						
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30			<u>63 64</u>		
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL						
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL						
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL						
NOT RECONSTRUCTED BECAUSE						
(02) INSUFFICIENT DATA						
(03) EXCESSIVE UNDERRIDE/OVERRIDE						
(04) ROLLOVER						
(05) VAULTING						
(06) OTHER TRAVEL IN MORE THAN ONE PLANE						
(07) NON-HORIZONTAL FORCE						
(08) SIDESWIPE-TYPE DAMAGE						
(09) YIELDING OBJECT						
(10) OTHER: _____						
(11) AT LEAST ONE VEHICLE BEYOND SCOPE						
(12) OTHER VEHICLE NOT INSPECTED						
MODE						
(1) CDC ONLY						
(2) CDC & DETAILED DAMAGE	<u>2</u> 31			<u>65</u>		
(3) TRAJECTORY & CDC						
(4) TRAJECTORY & CDC & DETAILED DAMAGE						
(5) NOT RECONSTRUCTED						
COMPUTER PROGRAM SPECIFY: <u>WIDMASH</u>						

Duplicate columns 1-8  
from the previous card.

Module C R Format 0 2  
9 10 11 12

# CRASH RECONSTRUCTION CR-2

for EBS

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13	<u>Trace</u>	<u>      </u> 47	
EBS (km/h) TOTAL	<u>037</u> 14 15 16	<u>8—</u> 32 33 34	<u>      </u> 48 49 50	<u>      </u> 66 67 68
LONGITUDINAL*	<u>-037</u> 17 20	<u>8—</u> 35 38	<u>      </u> 51 54	<u>      </u> 69 72
LATERAL*	<u>+000</u> 21 24	<u>8—</u> 39 42	<u>      </u> 55 58	<u>      </u> 73 76
*NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = <u>+010</u> -7 km/h = <u>-007</u>				
ENERGY DISSIPATED BY CRUSH (kj)	<u>0104</u> 25 28	<u>8—</u> 43 46	<u>      </u> 59 62	<u>      </u> 77 80
RECONSTRUCTION				
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30		<u>      </u> 63 64	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY				
(2) CDC & DETAILED DAMAGE	<u>2</u> 31		<u>      </u> 65	
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: <u>MINI SPAS 4</u>				

- NOTES:
1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
  2. MEASURE  $C_1$  TO  $C_6$  FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
  3.  $D$  IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
  4. USE THE CENTER OF THE WHEELBASE AS THE CG.

CASE VEHICLE

LOCATOR


Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	Begin LFB 57cm to right	Upper Rad support

VIEW = 150

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other \_\_\_\_\_
- (9) Unknown

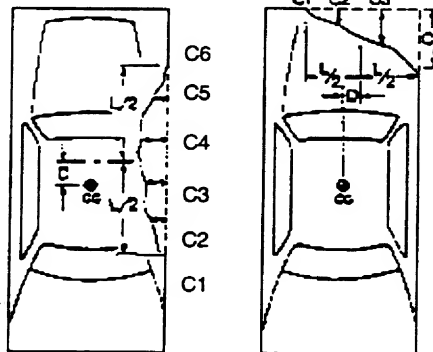

DL 57

UDL 93

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	C <sub>1</sub>	C <sub>2</sub>	C <sub>3</sub>	C <sub>4</sub>	C <sub>5</sub>	C <sub>6</sub>	±D
		Length (DDL)	Max Crush								
1	2	57	-67	132	67	56	50	45	41	45	-46
	stano Adjust		-13		-13	-13	-13	-13	-13	-13	
			-10		-10	-1	-1	-1	-7	-10	
1	2	057	044	132	044	042	036	031	021	022	-046
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2											

Duplicate columns 1-8  
from the previous card.

Module C R Format 0 4  
9 10 11 12

# CRASH RECONSTRUCTION CR-4

NOTES: 1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.

2. MEASURE  $C_1$  TO  $C_6$  FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.

3.  $D$  IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.

4. USE THE CENTER OF THE WHEELBASE AS THE CG.

OTHER VEHICLE


LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other \_\_\_\_\_
- (9) Unknown

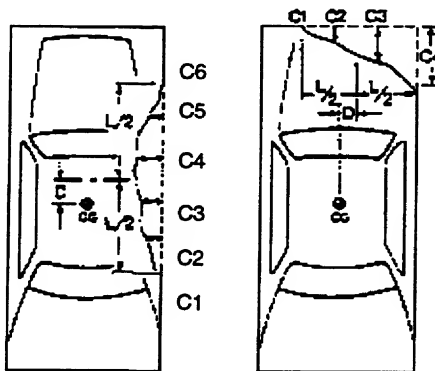

DL \_\_\_\_\_

UDL \_\_\_\_\_

## CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	$C_1$	$C_2$	$C_3$	$C_4$	$C_5$	$C_6$	$\pm D$
		Length (DDL)	Max Crush								
1											
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2											



Duplicate columns 1-8  
from the previous card.

Module W T Format 0 1  
9 10 11 12

# WHEELS AND TIRES

WT-1

## WHEELS--DAMAGED

- (0) NO  
(1) YES  
(9) UNKNOWN

LF 0  
13

RF 0

RR 0

LR 0  
16

*Flat*

## TIRE TREAD TYPE

- (1) REGULAR  
(2) SNOW  
(3) SLICKS  
(4) ALL WEATHER (MS)  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

LF 4  
17

RF 4

RR 4

LR 4  
20

## CARCASS CONSTRUCTION

- (1) BIAS  
(2) BELTED BIAS  
(3) RADIAL  
(4) ELLIPTICAL  
(5) HI PRESSURE SPARE  
(6) SPACE SAVER SPARE  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

LF 3  
21

RF 3

RR 3

LR 3  
24

SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S)

LF P 2 4 5 7 5 R 1 6  
25

RF ↓  
35

RR P 2 3 5 7 5 R 1 5  
45

LR P 2 4 5 7 5 R 1 6  
55

*Replacement for  
towing*

IF VEHICLE IS EQUIPPED WITH DUAL  
WHEELS, COMPLETE FOR OUTER WHEELS  
AND MAKE NOTES ON INNER WHEELS.

NOTES: \_\_\_\_\_

\_\_\_\_\_  
\_\_\_\_\_

Duplicate columns 1-8  
from the previous card.

Module F T Format 0 1  
9 10 11 12

# FUEL AND FUEL TANKS FT-1

## TYPE OF PROPULSIVE FUEL

- (1) GASOLINE
- (2) DIESEL OIL
- (3) LPG
- (4) ELECTRIC
- (7) OTHER: \_\_\_\_\_
- (9) UNKNOWN

1  
13

## AUXILIARY TANK TYPE

- (1) OEM TANK
- (2) AFTER MARKET TANK
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

8  
21

## MAIN TANK LOCATION

322  
14 16

## AUXILIARY TANK LOCATION

888  
22 24

## MAIN FILLER CAP LOCATION

313  
17 19

## AUXILIARY FILLER CAP LOCATION

888  
25 27

## MAIN TANK MATERIAL

3  
20

## AUXILIARY TANK MATERIAL

8  
28

## TANK AND FILLER CAP LOCATION CODES

### FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

### SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

### THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

## TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module F L Format 0 1  
9 10 11 12

FUEL LEAKAGE FL-1

# DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

0  
13

(1) YES COMPLETE PAGE.

LEAK NUMBER	I LEAKING COMPONENT	II COMPONENT SOURCE	III TYPE OF DAMAGE	IV SEVERITY OF DAMAGE	V LOCATION OF LEAK	EVENT NUMBER
#1	<u>14</u> <u>15</u>	<u>      </u>	<u>      </u>	<u>      </u>	<u>      </u> <u>      </u>	<u>21</u>
#2	<u>22</u> <u>23</u>	<u>      </u>	<u>      </u>	<u>      </u>	<u>      </u> <u>      </u>	<u>29</u>
#3	<u>30</u> <u>31</u>	<u>      </u>	<u>      </u>	<u>      </u>	<u>      </u> <u>      </u>	<u>37</u>
#4	<u>38</u> <u>39</u>	<u>      </u>	<u>      </u>	<u>      </u>	<u>      </u> <u>      </u>	<u>45</u>
#5	<u>46</u> <u>47</u>	<u>      </u>	<u>      </u>	<u>      </u>	<u>      </u> <u>      </u>	<u>53</u>

## I LEAKING COMPONENT

### TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

### DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

### EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

### EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN
- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

## II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

## III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

## IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

## V LOCATION OF LEAK

FIRST DIGIT  
(LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT  
(LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module F R Format 0 1  
9 10 11 12

FIRE FR-1

WAS THERE FIRE IN OR ON CASE VEHICLE?

(0) NO SKIP PAGE.

(1) YES COMPLETE PAGE.

0  
13

DID FIRE START IN CASE VEHICLE?

- (0) NO  
(1) YES  
(9) UNKNOWN

      
14

SEVERITY OF FIRE DAMAGE

- (1) MINOR  
(2) MODERATE  
(3) SEVERE  
(9) UNKNOWN

      
16

FLAME PROPOGATION RATE

- (1) RAPID/EXPLOSIVE  
(2) SLOW/MODERATE  
(9) UNKNOWN

      
15

DID AN INJURY TO CASE  
VEHICLE OCCUPANT RESULT FROM  
FIRE IN OR ON CASE VEHICLE?

- (0) NO  
(1) YES  
(9) UNKNOWN

      
17

PROVIDE NOTES IF FIRE OCCURRED.

Duplicate columns 1-8  
from the previous card.

Module E D Format 0 1  
9 10 11 12

## EXTERIOR DAMAGE

ED-1

### HOOD PERFORMANCE

FOR THE FOLLOWING, USE CODES:

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

HOOD LATCH(ES)- -RELEASED

9  
13

*couldn't find*

-DAMAGED

9  
14

-JAMMED

9  
15

HOOD HINGES- -LEFT, DAMAGED

1  
16

-LEFT, SEPARATED  
(COMPLETE)

0  
17

-RIGHT, DAMAGED

1  
18

-RIGHT, SEPARATED  
(COMPLETE)

0  
19

HOOD REMAINED ON VEHICLE

1  
20

REAR EDGE OF HOOD- -ELEVATED

1  
21

-CONTACTED WINDSHIELD

1  
22

-PENETRATED WINDSHIELD

0  
23

HOOD LATCH LOCATION

- (1) FRONT OF VEHICLE
- (2) COWL AREA
- (3) SIDE
- (8) NOT APPLICABLE
- (9) UNKNOWN

1  
24

### ENGINE OR TRANSMISSION MOUNT

SEPARATION (COMPLETE)

- (0) NO
- (1) YES
- (9) UNKNOWN

0  
25

### STEERING COL FLEXIBLE COUPLING

FLEXIBLE COUPLING TYPE

- (0) NONE
- (1) FLEXIBLE MATERIAL
- (2) POT
- (3) SINGLE U-JOINT
- (4) DOUBLE U-JOINT
- (5) FLEXIBLE CABLE
- (6) COMBINATION OF ABOVE  
(CIRCLE EACH)
- (7) OTHER: \_\_\_\_\_
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN, IF EQUIPPED

9  
26

COUPLING-

-DAMAGED

9  
27

(USE CODES  
FROM HOOD  
PERFORMANCE)

-SEPARATED  
(COMPLETE)

9  
28

### ENG COMPART TELESCOPING UNIT

TYPE OF UNIT

- (00) NONE INSTALLED
- (01) - (07) SEE UNITS ON PAGE ED-2
- (88) NOT COLLECTED
- (97) OTHER: \_\_\_\_\_
- (98) EQUIPPED, TYPE UNKNOWN
- (99) UNKNOWN IF EQUIPPED

8 8  
29 30

ORIGINAL LENGTH (mm)

F (OR H): \_\_\_\_\_

TELESCOPED LENGTH (mm)

G: \_\_\_\_\_

DIFFERENCE (mm)

F (OR H) - G

(IF LESS THAN 15mm, ENTER "000".)

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO  
COMPRESSION
- (992) COMPRESSED, AMOUNT  
UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT  
EQUIPPED)
- (999) UNKNOWN

8 8 8  
31 32 33

## LEFT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

0  
 34

## LEFT DOORS

HOW DID DOORS  
OPEN DURING COLLISION?

USE CODES:

(0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION  
 (2) DOOR-LATCH SEPARATION  
 (3) LATCH-STRIKER SEPARATION  
 (4) STRIKER-PILLAR SEPARATION  
 (5) BODY DISTORTION  
 (6) COMBINATION OF ABOVE  
 (CIRCLE EACH)  
 (7) OPENED, REASON UNKNOWN

- (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

-FRONT

0  
 43

-REAR

8  
 44

## DOORS JAMMED CLOSED-

USE CODES:

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

-FRONT

0  
 45

-REAR

8  
 46

## LEFT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO  
 (1) YES  
 (4) NO SEPARATION, BUT DAMAGED  
 (8) NOT APPLICABLE (NOT EQUIPPED)  
 (9) UNKNOWN

-A-PILLAR, UPPER

0  
 35

LOWER

0  
 36

-B-PILLAR, UPPER

0  
 37

LOWER

0  
 38

-C-PILLAR, UPPER

0  
 39

LOWER

8  
 40

-D-PILLAR, UPPER

8  
 41

LOWER

8  
 42

## REAR DOOR


## REAR DOOR TYPE

- (0) NO DOOR (INCLUDES PICKUPS)
- (1) HATCHBACK
- (2) ONE-WAY TAILGATE
- (3) TWO-WAY TAILGATE
- (4) CLAMSHELL/DISAPPEARING TAILGATE
- (5) SINGLE DOOR
- (6) DOUBLE DOOR
- (9) UNKNOWN

Hatchback



One-way



Two-way



or



Clamshell



Single door



Double door

HOW DID DOOR  
OPEN DURING COLLISION?

- (0) DOOR DID NOT OPEN

## OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
- (2) DOOR-LATCH SEPARATION
- (3) LATCH-STRIKER SEPARATION
- (4) STRIKER-PILLAR SEPARATION
- (5) BODY DISTORTION
- (6) COMBINATION OF ABOVE  
(CIRCLE EACH)
- (7) OPENED, REASON UNKNOWN
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

## DOOR JAMMED CLOSED

- (0) NO
- (1) YES
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

47

## OTHER REAR DAMAGE

WAS PARTITION TO LUGGAGE AREA  
DAMAGED DURING COLLISION?

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

50

## SPARE TIRE

- (0) NO SPARE TIRE
- (1) NOT ATTACHED BEFORE COLLISION
- (2) ATTACHED, NOT SEPARATED IN COLLISION
- (3) ATTACHED, SEPARATED DUE TO COLLISION
- (8) NOT COLLECTED
- (9) UNKNOWN

51

## TRAILER HITCH TYPE

- (0) NO HITCH

## BALL-AND-SOCKET TYPES

- (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON)
- (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK)
- (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING)
- (4) LOAD EQUALIZING

## OTHER TYPES

- (5) RING-AND-PINTLE
- (6) FIFTH-WHEEL (INCL. P/U)
- (7) OTHER (E.G. CLEVIS-AND-PIN)

- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN IF EQUIPPED

52

TRAILER TYPE  
(AT TIME OF COLLISION)

- (0) NO TRAILER
- (1) TRAVEL-TRAILER/CAMPER
- (2) MOBILE HOME
- (3) BOAT/SNOWMOBILE/ATV TRAILER
- (4) UTILITY TRAILER
- (5) TOWED CAR
- (7) OTHER: \_\_\_\_\_
- (8) TRAILER, TYPE UNKNOWN
- (9) UNKNOWN

53

48

49

## RIGHT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

0  
 54

## RIGHT DOORS

HOW DID DOORS  
OPEN DURING COLLISION?

USE CODES:

(00) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (01) HINGE AREA SEPARATION  
 (02) DOOR-LATCH SEPARATION  
 (03) LATCH-STRIKER SEPARATION  
 (04) STRIKER-PILLAR SEPARATION  
 (05) BODY DISTORTION  
 (06) COMBINATION OF ABOVE  
 (CIRCLE EACH)  
 (07) OPENED, REASON UNKNOWN  
 (11) VAN RIGHT-REAR DOOR OPENED  
 (ANY MECHANISM)

(98) NOT APPLICABLE (NO DOOR)

(99) UNKNOWN

-FRONT

0 0  
 63 64

-REAR

8 8  
 65 66

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

-FRONT

0  
 67

-REAR

8  
 68

VAN REAR DOOR TYPE

- (0) VAN, NO REAR DOOR  
 (1) TRACK (SLIDING) - RIGHT SIDE  
 (2) SINGLE-HINGED - RIGHT SIDE  
 (3) DOUBLE-HINGED - RIGHT SIDE  
 (4) TRACK (SLIDING) - RIGHT & LEFT SIDE  
 (5) SINGLE-HINGED - RIGHT & LEFT SIDE  
 (6) DOUBLE-HINGED - RIGHT & LEFT SIDE  
 (7) TRACK AND HINGED COMBINATION  
 (8) NOT APPLICABLE (NOT A VAN)  
 (9) UNKNOWN

8  
 69

## RIGHT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO  
 (1) YES  
 (4) NO SEPARATION, BUT DAMAGED  
 (8) NOT APPLICABLE (NOT EQUIPPED)  
 (9) UNKNOWN

-A-PILLAR, UPPER

0  
 55

LOWER

0  
 56

-B-PILLAR, UPPER

0  
 57

LOWER

0  
 58

-C-PILLAR, UPPER

0  
 59

LOWER

8  
 60

-D-PILLAR, UPPER

8  
 61

LOWER

8  
 62



## WINDSHIELD DAMAGE

## WINDSHIELD CRACKED

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

WINDSHIELD BROKEN  
(PLASTIC INTERLAYER TORN)

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

CRACKED OR BROKEN  
BY OCCUPANT CONTACT

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

## EXTENT OF BOND SEPARATION

- (0) NONE  
 (1) 1 - 20%  
 (2) 21 - 40  
 (3) 41 - 60  
 (4) 61 - 80  
 (5) 81 - 99  
 (6) TOTAL  
 (7) SEPARATED, AMOUNT  
 UNKNOWN  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

1  
70

0  
71

1  
72

0  
73

## WINDSHIELD MARK ON CASE VEHICLE:

## SOLAR TINT

**Carlite**

AS-1

(D)

(R)

LAMINATED

SUN VISOR

DOT-75 FM M207

9

D

LB

DW-1137

## WINDSHIELD CODE

- (97) DESCRIBED BUT NOT CODED  
 (98) NOT APPLICABLE (NO WINDSHIELD)  
 (99) UNKNOWN

97  
74 75


## ROOF

DID T-ROOF/SUN ROOF OPEN  
DURING COLLISION?

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (NOT A T-ROOF OR SUN ROOF)  
 (9) UNKNOWN

8  
76

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

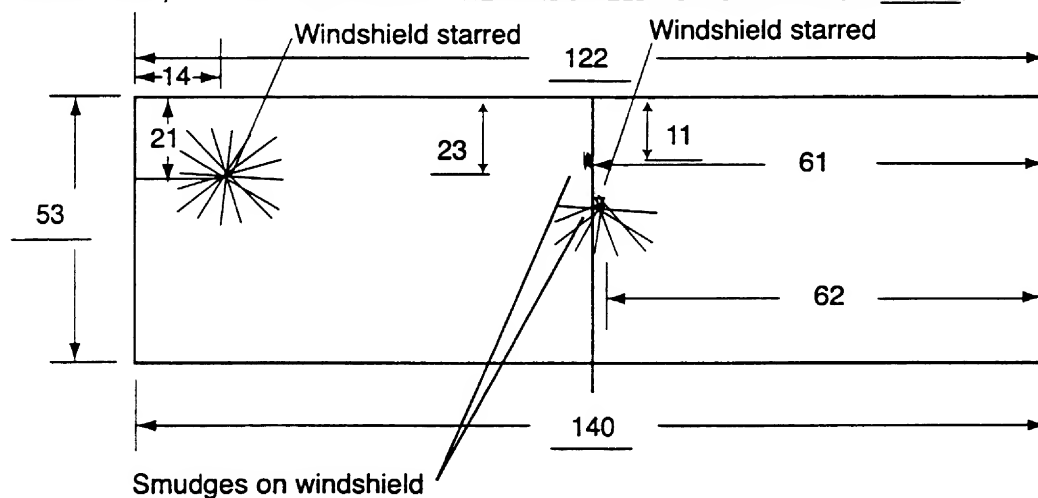

L

C

R

## STEERING WHEEL

### STEERING WHEEL RIM DAMAGE

- (0) NONE  
(1) DEFORMED SLIGHTLY  
(2) SEVERELY BENT  
(3) BROKEN  
(9) UNKNOWN

*upper  
stake*

1  
13

### NUMBER OF STEERING WHEEL SPOKES

- (9) UNKNOWN

4  
14

### STEERING WHL SPOKE DAMAGE

- (0) NONE  
(1) DEFORMED SLIGHTLY  
(2) SEVERELY BENT  
(3) BROKEN  
(9) UNKNOWN

0  
15

### STEERING WHEEL POSITION AT TIME OF COLLISION

IN WHAT O'CLOCK POSITION WAS THE  
NORMAL TOP OF THE WHEEL POINTED  
WHEN THE COLLISION OCCURRED?

#### EXAMPLES

O'CLOCK = 12



(NORMAL STRAIGHT  
AHEAD)

O'CLOCK = 99



O'CLOCK = 99


(99) UNKNOWN

## STEERING WHEEL ENERGY ABSORBING DEVICE



(1) EXAMPLES:

BARRACUDA, 70 - 74  
CHALLENGER, 70 - 74  
CAPRI, 71 - 77

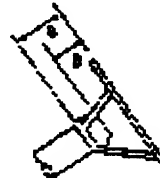

(2) EXAMPLES:

OMNI, 78 -  
HORIZON, 78 -

## STEERING COLUMN OPTIONS

### TILT FEATURE

- (0) NOT EQUIPPED  
(1) YES, EQUIPPED, UNK POSITION  
(2) UP  
(3) MIDDLE  
(4) LOWER  
(9) UNKNOWN IF EQUIPPED

4  
16

### SWING-AWAY FEATURE

- (0) NOT EQUIPPED  
(1) YES, EQUIPPED  
(9) UNKNOWN IF EQUIPPED

0  
17

### TELESCOPING FEATURE

- (0) NOT EQUIPPED  
(1) YES, EQUIPPED  
(9) UNKNOWN IF EQUIPPED

0  
18

### TYPE OF DEVICE

- (0) NONE  
(1) CONVOLUTED OR MESH CYLINDER  
(2) DEEP DISH STEERING WHEEL  
(7) OTHER: \_\_\_\_\_  
(8) NOT COLLECTED  
(9) UNKNOWN IF EQUIPPED

8  
19

### ORIGINAL DIMENSION (mm)

A: \_\_\_\_\_

### DAMAGE DIMENSION (mm)

B: \_\_\_\_\_

### DIFFERENCE (mm)

A - B

- (888) NOT COLLECTED  
(991) NOT MEASURED/NO APPARENT  
COMPRESSION  
(992) COMPRESSED, AMOUNT UNKNOWN  
(993) DEVICE EXTENDED  
(997) UNABLE TO MEASURE  
(998) NOT APPLICABLE (NOT EQUIPPED)  
(999) UNKNOWN

8 8 8  
20 22

# STEERING COLUMN ENERGY ABSORBING DEVICE

TYPE OF DEVICE \* (IF 27 OR 28)

- (00) NOT EQUIPPED  
(88) NOT COLLECTED  
(99) UNKNOWN

8 8  
23 24

ORIGINAL LENGTH (mm)

C: \_\_\_\_\_

COMPRESSED LENGTH (mm)

D: \_\_\_\_\_

BRACKET DEFLECTION (IF CODE 36, 48,  
OR 49 ABOVE)

OR

COMPRESSION (OR EXTRUSION) (mm)

C - D (OR E) (TOLERANCE:  $\pm 10$ )

- (888) NOT COLLECTED  
(991) NOT MEASURED/NO APPARENT  
COMPRESSION  
(992) COMPRESSED, AMOUNT UNKNOWN  
(993) DEVICE EXTENDED  
(997) UNABLE TO BE MEASURED  
(998) NOT APPLICABLE (NOT EQUIPPED)  
(999) UNKNOWN


8 8 8  
25 27

\* (ADD A &amp; B FOR TOTAL COMPRESSION)

SHEAR CAPSULE SEPARATION (mm)

S (USE AVG. OF LEFT &amp; RIGHT CAPSULES.)

LT:

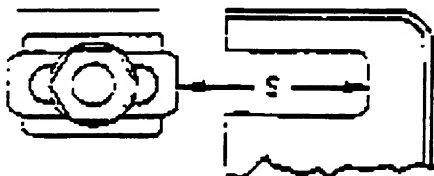

RT:

- (888) NOT COLLECTED  
(991) NOT MEASURED/NO APPARENT  
SEPARATION  
(992) SEPARATED, AMOUNT UNKNOWN  
(997) UNABLE TO BE MEASURED  
(998) NOT APPLICABLE (NOT EQUIPPED)  
(999) UNKNOWN

8 8 8  
28 30

## COLUMN VERTICAL ROTATION

- (0) NO APPARENT ROTATION  
(1) UPWARD APPARENT ROTATION  
(2) DOWNWARD APPARENT ROTATION  
(9) UNKNOWN

0  
31

## COLUMN LATERAL ROTATION

- (0) NO APPARENT ROTATION  
(1) LEFT APPARENT ROTATION  
(2) RIGHT APPARENT ROTATION  
(9) UNKNOWN

0  
32

## STEERING WHEEL (CONTINUED)

## STEERING WHEEL HUB DAMAGE

- (0) NONE  
(1) OCCUPANT CONTACT  
(2) AIRBAG  
(3) OTHER \_\_\_\_\_  
(9) UNKNOWN

0  
33



	INTRUSION    IT-1
--	-------------------

[illegible]

OCCUPANT CONTACT WORKSHEET									
----------------------------	--	--	--	--	--	--	--	--	--

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A					
B					
C					
D					
E					
F					
G					
H					
I					
J					

1 = Definitely 2 = Probably 3 = Possible


## INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction
		Comparison Value	– Intruded Value	= Intrusion	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	

## OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Windshield	DR		Glass cracked and smudge mark	2
B	Knee bolster	DR	Lt. knee	Black mark	3
C	Knee bolster	DR	Rt. knee	Scuff-mark	1
D	Windshield	RF	Head	Glass cracked and smudge mark	1
E	Windshield	RF	Head	Glass cracked and smudge mark	1
F	Rearview mirror	RF	Head	knocked off mount	1
G	Glove box	RF	Rt. knee	indentation	1
H					
I					
J					
K					

## VEHICLE OCCUPANT CONTACT DIAGRAM

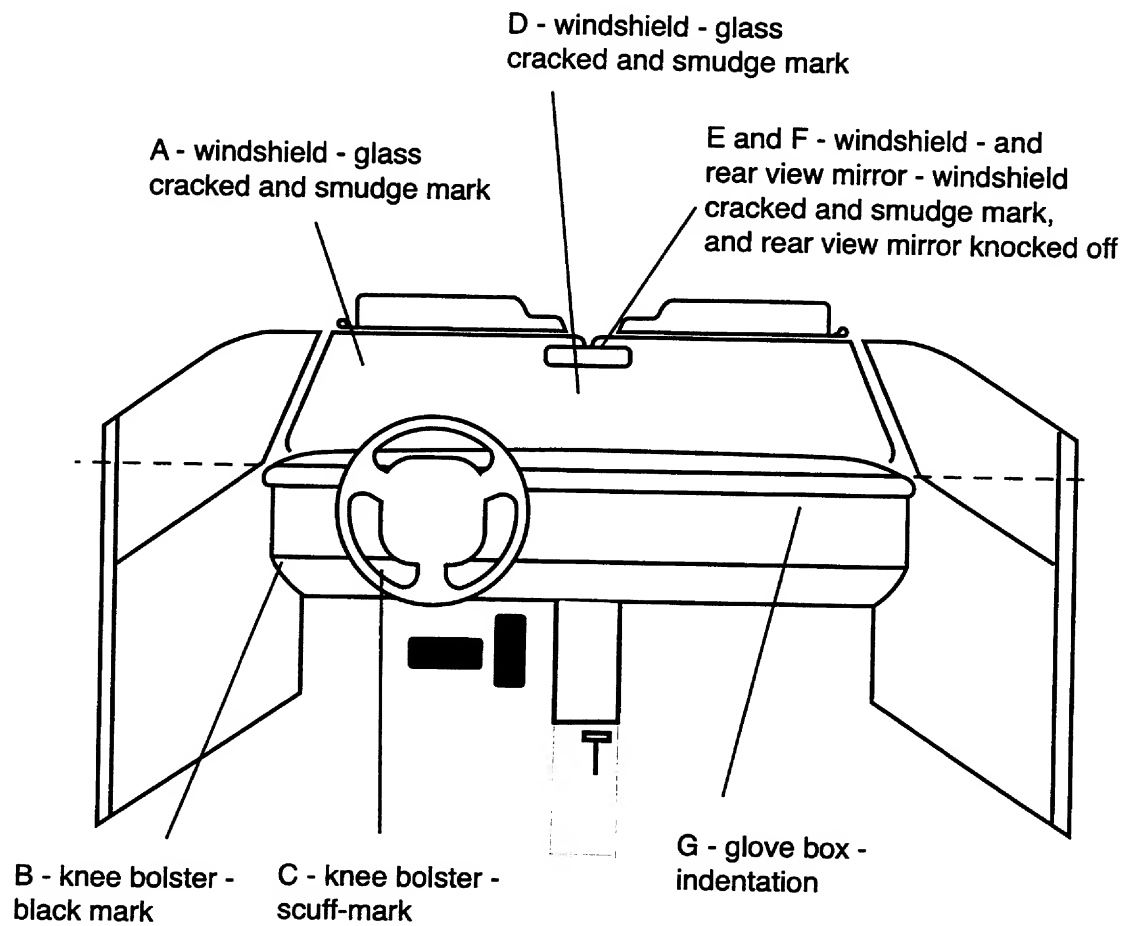

## CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

## FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

## SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

- |                          |                 |                         |   |
|--------------------------|-----------------|-------------------------|---|
| (1) LEFT                 | (3) RIGHT       | .....                   | INDIVIDUAL SEAT                               |
| (1) LEFT                 | (2) CENTER      | (3) RIGHT               | ..... BENCH: FULL WIDTH 3 PASSENGER           |
| (1) LEFT                 | (2) LEFT CENTER | (6) RIGHT CENTER        | (3) RIGHT ..... BENCH: FULL WIDTH 4 PASSENGER |
| (1) LEFT                 | (2) CENTER      | (5) RIGHT & AISLE SPACE | ..... BENCH: PARTIAL WIDTH, LEFT              |
| (0) LEFT & SPACE         | (2) CENTER      | (5) RIGHT & SPACE       | ..... BENCH: PARTIAL WIDTH, CENTERED          |
| (4) ENTIRE VEHICLE WIDTH | .....           | CARGO AREA              |   |

## EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR  
5 PASSENGERS

X	X	11	13
X	X	X	21 22 23

VAN  
12 PASSENGER CAPACITY

X	X	11	13
X	X	X	21 22 25
X	X	X	31 32 35
X	X	X	X 41 42 46 43

## CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)  
(Y) Y-AXIS (LATERAL)  
(Z) Z-AXIS (VERTICAL)

## CODES FOR COLUMNS G, H, I &amp; J, OCCUPANT &amp; INJURY NUMBERS

OCCUPANT NUMBER	INJURY NUMBER	<u>CONTACT</u>
(00)	(00)	NO CONTACT
(##)	(00)	CONTACT, NO INJURY
(97)	(99)	CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN
(99)	(00) OR (99)	UNKNOWN IF CONTACT





## CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

*NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.*

## INDIVIDUAL COMPONENT

## INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/  
SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (*DESCRIBE*)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

## EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER  
COMPARTMENT BUT PART  
OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (*E.G. SPARE TIRE,  
JACK. DESCRIBE.*)
- (49) UNKNOWN EXTERNAL OBJECT

## GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

*USE ONLY IF ALL THESE COMPONENTS  
INTRUDED INTO A SINGLE OCCUPANT SPACE.*

- |                        |                         |
|------------------------|-------------------------|
| (50) WINDSHIELD HEADER | (60) ROOF               |
| A-PILLAR               | ROOF RAIL               |
| ROOF SIDE RAIL         | A-PILLAR                |
|                        | B-PILLAR                |
| (51) INSTRUMENT PANEL  | C-PILLAR                |
| A-PILLAR               | WINDOW FRAME            |
| DOOR PANEL             | DOOR PANEL              |
|                        | FLOOR PAN               |
| (52) INSTRUMENT PANEL  | (61) INSTRUMENT PANEL   |
| A-PILLAR               | TOE PAN                 |
| WINDSHIELD HEADER      | WINDSHIELD HEADER       |
|                        | A-PILLAR                |
| (53) DOOR PANEL        | ROOF RAIL               |
| B-PILLAR               | WINDOW FRAME            |
| ROOF RAIL              | DOOR PANEL              |
|                        | ROOF                    |
| (54) DOOR PANEL        | (62) ROOF               |
| A-PILLAR               | ROOF RAIL               |
| ROOF RAIL              | C-PILLAR                |
|                        | WINDOW FRAME            |
| (55) INSTRUMENT PANEL  | FLOOR PAN               |
| FLOOR PAN              | SECOND SEAT             |
| A-PILLAR               | DOOR PANEL              |
| DOOR FRAME             |                         |
| (56) ROOF RAIL         | (63) ROOF RAIL          |
| A-PILLAR               | ROOF                    |
| B-PILLAR               | B-PILLAR                |
| WINDOW FRAME           | WINDOW FRAME            |
|                        | FLOOR PAN               |
| (57) ROOF RAIL         | DOOR PANEL              |
| A-PILLAR               | SECOND SEAT             |
| B-PILLAR               | FRONT SEAT              |
| C-PILLAR               |                         |
| DOOR PANEL             | (64) ROOF RAIL          |
|                        | ROOF OR CONVERTIBLE TOP |
| (58) ROOF              | A-PILLAR                |
| ROOF RAIL              | B-PILLAR                |
| WINDOW FRAME           | WINDOW FRAME            |
| DOOR PANEL             | WINDOW HEADER           |
| (59) BACKLIGHT HEADER  | (65) WINDSHIELD         |
| ROOF                   | WINDSHIELD HEADER       |
| C-PILLAR               | ROOF SIDE RAIL          |
| THIRD SEAT-BACK        |                         |
|                        | (66) WINDSHIELD         |
|                        | WINDSHIELD HEADER       |
|                        | A-PILLAR                |
|                        |                         |
|                        | (98) NOT APPLICABLE     |
|                        | (99) UNKNOWN            |

Duplicate columns 1-8  
from the previous card.

Module 1 1 Format 0 1  
9 10 11 12

INTRUSION IT-5

WAS THERE OCCUPANT COMPARTMENT INTRUSION? 0

13

WAS INTRUSION CATASTROPHIC?     

14

- (0) NO DO NOT ANSWER NEXT QUESTION. SKIP PAGE.  
(1) YES ANSWER NEXT QUESTION.  
(9) UNKNOWN SKIP PAGE.

- (0) NO COMPLETE PAGE.  
(1) YES SKIP PAGE.

Duplicate columns 1-8  
from the previous card.

Module 1 1 Format 0 2  
9 10 11 12

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

**INTRUSIONS** CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.  
CODES FOR B, F, G, H, I, J ON PAGE IT-3  
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION	OCC.	INTRUDING	ASSOC.	MAXIMUM	MAXIMUM	MAXIMUM	OCCUPANT	INJURY	OCCUPANT	INJURY
NUMBER	SPACE NO.	COMPONENT	EVENT	INTRUSION	INTRUSION	INTRUSION	NUMBER	NUMBER	NUMBER	NUMBER
		OR OBJECT	NO.	X AXIS (cm)	Y AXIS (cm)	Z AXIS (cm)				
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0</u> <u>1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0</u> <u>2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0</u> <u>3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0</u> <u>4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0</u> <u>5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0</u> <u>6</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0</u> <u>7</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

NOTE: USE ADDITIONAL PAGE IF MORE THAN 7 INTRUSIONS.

Duplicate columns 1-8  
from the previous card.

Module 1 1 Format 0 3  
9 10 11 12

NOTE: IF NO SIDE DOOR INTRUSION,  
SKIP REMAINDER OF PAGE.

**SIDE DOOR INTRUSION  
RESULTED FROM**

INTRUSION  
NUMBER CAUSE

CODES  
FOR CAUSE:

13 — (1) DIRECT  
16 — 18 IMPACT  
19 — 21 (2) INDUCED  
(9) DAMAGE  
UNKNOWN

**IF DAMAGE TO DOOR COMPONENT RESULTED IN INCREASED  
DOOR INTRUSION, CODE COMPONENT**

INTRUSION  
NUMBER

DAMAGED  
COMPONENT 1

DAMAGED  
COMPONENT 2

CODES  
FOR COMPONENTS

A — —  
22 23

B — —  
26 27

C — —  
30 31

D — —  
34 35

—

—

—

—

25

29

33

37

- (0) NONE  
(1) A-PILLAR  
(2) B-PILLAR  
(3) C-PILLAR  
(4) LATCH/STRIKER  
(5) HINGES  
(7) OTHER:       
(8) NOT APPLICABLE  
(9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module I T Format 0 2  
9 10 11 12

INTRUSION IT-6

NOTE: Each line in the table below is a separate record (card).  
Duplicate columns 1 - 12 for each completed line.

-- ADDITIONAL PAGE --

**INTRUSIONS** CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.  
CODES FOR B, F, G, H, I, J ON PAGE IT-3  
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 8</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 9</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 0</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 1</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 2</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 3</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 4</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 5</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 6</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 7</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 8</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 9</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 0</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 1</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 2</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 3</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 4</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 5</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —

Duplicate columns 1-8  
from the previous card.

Module I D Format 0 1  
9 10 11 12

# INTERIOR DAMAGE

ID-1

## CODES:

(0) NO  
(1) YES  
(3) NO, and OCCUPANT CONTACT

(4) YES, and OCCUPANT CONTACT  
(8) NOT APPLICABLE  
(9) UNKNOWN

	LEFT	RIGHT				
<b>SIDES</b>			<b>FRONT</b>			<b>INSTRUMENT PANEL</b>
FRONT DOOR	<u>0</u> 13	<u>0</u> 14	FOOT CONTROLS	<u>0</u> 45		UPPER PANEL
FRONT HARDWARE	<u>0</u> 15	<u>0</u> 16	IGNITION KEYS	<u>0</u> 46		MID PANEL
FRONT ARMREST	<u>0</u> 17	<u>0</u> 18	REAR VIEW MIRROR	<u>4</u> 47		LOWER PANEL
FRONT GLASS	<u>0</u> 19	<u>0</u> 20	SUNVISOR/FITTINGS	<u>0</u> 48		ASHTRAY
REAR DOOR AREA	<u>0</u> 21	<u>0</u> 22	(5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES			CONTROL KNOBS & LEVERS
REAR HARDWARE	<u>0</u> 23	<u>0</u> 24	WINDSHIELD TOP MOLDINGS	<u>0</u> 49		GLOVE COMPARTMENT AREA
REAR ARMREST	<u>8</u> 25	<u>8</u> 26	LEFT A-PILLAR (UPPER OR LOWER)	<u>0</u> 50		INSTRUMENTS
REAR GLASS	<u>0</u> 27	<u>0</u> 28	RIGHT A-PILLAR (UPPER OR LOWER)	<u>1</u> 51		PARKING BRAKE RELEASE
ROOF SIDE RAIL	<u>0</u> 29	<u>0</u> 30	CENTER CONSOLE	<u>0</u> 52		PARKING BRAKE PEDAL
B-PILLAR	<u>0</u> 31	<u>0</u> 32	TRANSMISSION SELECTOR LEVER	<u>0</u> 53		A/C OR UPPER VENT OUTLETS
C-PILLAR	<u>0</u> 33	<u>0</u> 34	RIM, HORN, SPOKE	<u>0</u> 54		HEATER OR A/C DUCTS
D-PILLAR	<u>8</u> 35	<u>8</u> 36				RADIO
HEADLINING	<u>0</u> 37	<u>0</u> 38				OTHER: * _____
ROOF STRUCTURE	<u>0</u> 39	<u>0</u> 40				_____
T-ROOF/SUN ROOF	<u>8</u> 41	<u>8</u> 42				
OTHER: * _____	<u>8</u> 43	<u>8</u> 44				
						<b>REAR</b>
						WINDOW
						WINDOW HEADER
						CONSOLES
						VERTICAL
						ROOF

\* MORE THAN ONE ITEM MAY BE NOTED.

Duplicate columns 1-8  
from the previous card.

Module S T Format 0 2  
9 10 11 12

SEATS

ST-1

FRONT SEAT		DRIVER	PASSENGER	FRONT SEAT-BACK		DRIVER	PASSENGER
<b>TYPE OF FRONT SEAT</b> (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (97) OTHER: _____ (99) UNKNOWN		<u>03</u> 13 14	<u>03</u> 15 16	<b>SEAT-BACK TYPE</b> (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 30	<u>1</u> 31
<b>TYPE OF SEAT MOUNT</b> (1) STANDARD (2) PEDESTAL (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 17	<u>1</u> 18	<b>SEAT-BACK LOCK TYPE</b> (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 32	<u>1</u> 33
<b>SWIVEL MECHANISM EQUIPPED</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 19	<u>0</u> 20	<b>LOCKS HELD</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 34	<u>1</u> 35
<b>ORIGINAL EQUIPMENT SEATS</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 21	<u>1</u> 22	<b>RECLINER MECHANISM HELD</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 36	<u>1</u> 37
<b>CONTACT OF SEAT BY REAR OCCUPANT</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 23	<u>✓</u> 24	<b>HEAD RESTRAINT</b> <b>HEAD RESTRAINT TYPE</b> (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>2</u> 38	<u>2</u> 39
<b>FRONT SEAT DAMAGE</b> (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 25	<u>0</u> 26	<b>REMOVED PRE-CRASH</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 40	<u>8</u> 41
<b>CENTER ARMREST DAMAGED</b> (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED		<u>0</u> 27		<b>ADJUSTMENT AT CRASH</b> (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 42	<u>8</u> 43
<b>FRONT SEAT ROTATION</b> (0) NONE APPARENT (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 28	<u>0</u> 29	<b>HEAD RESTRAINT DAMAGE</b> (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 44	<u>0</u> 45


	SEATS ST-2					
<b>FRONT SEAT ADJUSTMENT</b>  SEAT ADJUSTMENT TYPE  (0) NONE ( <i>RIGID</i> ) (1) MANUAL (2) POWER (7) OTHER: (8) NOT APPLICABLE ( <i>NO SEAT</i> ) (9) UNKNOWN  ADJUSTMENT PROVIDED  (1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN  SEAT ADJUSTER DAMAGE (0) NONE (1) CHUCKING ( <i>FREE PLAY</i> ) (2) DEFORMED ( <i>RELEASED/JAMMED</i> ) (3) SEPARATED (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN  SEAT ADJUSTER SEPARATION (0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN  PRE-CRASH POSITION  (1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN	DRIVER	PASSENGER	<b>SECOND SEAT (CONT.)</b>  CENTER ARMREST DAMAGED  (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE ( <i>NO CENTER ARMREST</i> ) (9) UNKNOWN IF EQUIPPED			
<b>SECOND SEAT</b>  TYPE OF SECOND SEAT  (0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN  SECOND SEAT DAMAGE (0) NONE (1) BACKREST ONLY ( <i>DAMAGED OR LOOSENED</i> ) (2) CUSHION ONLY ( <i>DAMAGED OR LOOSENED</i> ) (3) BACKREST & CUSHION ( <i>DAMAGED OR LOOSENED</i> ) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL ( <i>DAMAGED OR LOOSENED</i> ) (8) NOT APPLICABLE (9) UNKNOWN	LEFT	RIGHT	<b>THIRD SEAT</b>  EQUIPPED  BACKREST DAMAGED  CUSHION DAMAGED			
			<b>VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS</b>  (0) NOT EQUIPPED ( <i>OR REMOVED</i> ) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE ( <i>NO REAR SEAT</i> ) (9) UNKNOWN  <i>Applies to any rear-seat position</i>			

<p>DRIVER SIDE</p> <p>LOCATION OF AIRBAG STEERING WHEEL</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 13</p> <p><u>1</u> 14</p>	<p>PASSENGER SIDE</p> <p>LOCATION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX)</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 16</p> <p><u>0</u> 17</p>
<p>CONDITION OF AIRBAG STEERING WHEEL</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 15</p>	<p>CONDITION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX)</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>8</u> 18</p>
<p>DRIVER SIDE</p> <p>AIRBAG STEERING WHEEL</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 19</p> <p><u>0</u> 20</p>	<p>PASSENGER SIDE</p> <p>AIRBAG INSTRUMENT PANEL (GLOVE BOX)</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>8</u> 21</p> <p><u>8</u> 22</p>




AIRBAG NUMBER ON DRIVER SIDE:

Driver Airbag

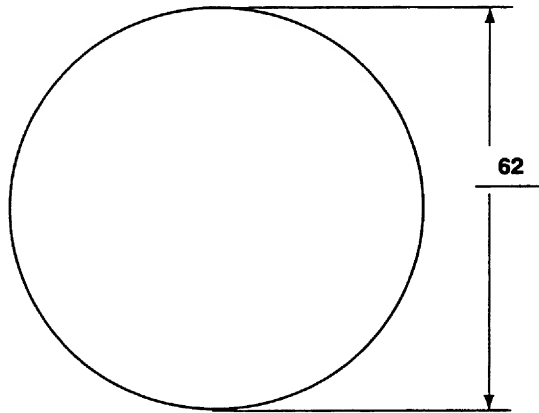

Driver Airbag Doors

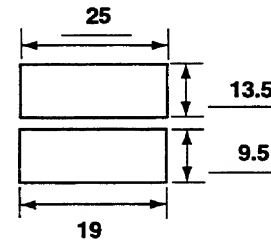


Vents: ☒ Y ☐ N  
if yes, how many: 2  
11 and 1 O'clock

Tethers: ☒ Y ☐ N  
if yes, how many: 2


AIRBAG NUMBER ON PASSENGER SIDE:

Passenger Airbag

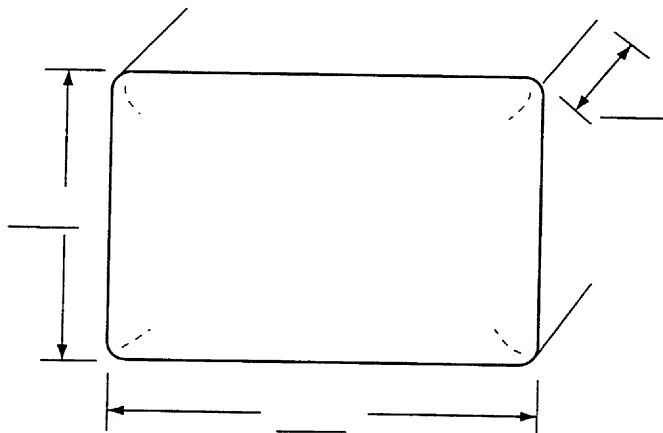

Passenger Airbag Door

Single Door

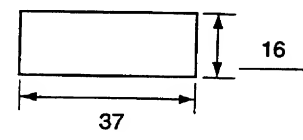

**Airbag turned off**

Vents: ☐ Y ☐ N  
if yes, how many: \_\_\_\_\_

Tethers: ☐ Y ☐ N  
if yes, how many: \_\_\_\_\_

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,  
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,  
ARE TO BE FILLED IN  
FOR EACH CASE VEHICLE OCCUPANT,  
WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,  
USE ADDITIONAL COPIES  
OF PAGES OC-1, OC-2, OC-3,  
AND IC-2 TO DESCRIBE THEM  
AND ATTACH THE COPIES TO THIS REPORT.

Duplicate columns 1-8  
from the previous card.

Module 0 C Format 0 2  
9 10 11 12

# OCCUPANT INFORMATION OC-1

## OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

01  
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
- (2) MOTOR VEHICLE PASSENGER  
(NOT DRIVER)
- (9) UNKNOWN

1  
15

## OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
- (2) SECOND
- (3) THIRD
- (4) FOURTH
- (7) OTHER: \_\_\_\_\_
- (8) EXTERNAL TO PASSENGER  
COMPARTMENT (E.G. BED OF PICKUP)
- (9) UNKNOWN

1  
16

LATERAL LOCATION

- (1) LEFT
- (2) LEFT CENTER
- (3) CENTER
- (4) RIGHT CENTER
- (5) RIGHT
- (6) ALL (LYING ON SEAT)
- (8) EXTERNAL TO PASSENGER  
COMPARTMENT
- (9) UNKNOWN

1  
17

POSTURE

- (10) SITTING ON SEAT
- (11) SITTING ON SEAT IN ABNORMAL  
POSITION (E.G. FEET ON DASH,  
SIDEWAYS)
- (12) SITTING ON CONSOLE
- (20) ON LAP OR IN ARMS
- (30) STANDING ON SEAT
- (40) STANDING ON FLOOR
- (47) STANDING, EXTERNAL TO  
PASSENGER COMPARTMENT
- (50) IN BASSINET
- (60) IN CHILD SEAT
- (65) IN CHILD HARNESS
- (70) LYING ON SEAT
- (80) LYING/SITTING ON PASSENGER  
FLOOR
- (83) LYING/SITTING ON OTHER  
OBJECT IN PASSENGER  
COMPARTMENT: \_\_\_\_\_
- (85) ON CARGO FLOOR/FOLDED  
SEAT-BACK
- (87) LYING/SITTING, EXTERNAL TO  
PASSENGER COMPARTMENT
- (97) OTHER: \_\_\_\_\_
- (99) UNKNOWN

10  
18 19

## PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
- (98) 98 YEARS OR OLDER
- (99) UNKNOWN

27  
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
- (25) 25 MONTHS OR OLDER
- (99) UNKNOWN

25  
22 23

MASS (kg)

- (999) UNKNOWN

(160 lb)

073  
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(5 ft, 9 in)

175  
27 28 29

SEX

- (1) MALE
- (2) FEMALE
- (9) UNKNOWN

1  
30

## MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
- (01) FIRST AID AT SCENE
- (02) TREATED AT HOSPITAL/CLINIC  
BUT NOT ADMITTED
- (03) HOSPITALIZED FOR OBSERVATION  
LESS THAN 24 HOURS
- (04) HOSPITALIZED OVER 24 HOURS  
OR FOR SIGNIFICANT TREATMENT
- (05) FATAL, DEAD AT SCENE
- (06) FATAL, DOA
- (07) FATAL, DEAD WITHIN 24 HOURS
- (08) FATAL, DEAD 24 HOURS TO  
31 DAYS LATER
- (09) FATAL, DEAD 31 DAYS TO  
1 YEAR LATER
- (10) FATAL DEAD WITHIN UNKNOWN  
PERIOD
- (99) UNKNOWN

02  
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

05  
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
- (1) YES, TIME & TYPE UNKNOWN
- (2) PRE-CRASH FATAL (CLINICAL  
DEATH AT WHEEL)
- (3) PRE-CRASH NON-FATAL (E.G.  
PRIOR INJURY, STROKE)
- (4) PREGNANT
- (5) POST-CRASH FATAL (DROWNING)
- (6) POST-CRASH NON-FATAL INJURY
- (7) OTHER: \_\_\_\_\_
- (8) COMBINATION OF ABOVE  
(CIRCLE EACH)
- (9) UNKNOWN

0  
35

# OCCUPANT INFORMATION OC-2

## MEDICAL CONDITIONS (CONT.)

### POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,  
SEVERITY UNKNOWN
- (9) UNKNOWN

2  
36

## CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE  
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

8 8  
41 42

## CHILD SEAT MAKE/MODEL

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

## RESTRAINT SYSTEM

### ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &  
SHOULDER HARNESS
- (9) UNKNOWN

3  
37

### ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &  
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

0  
38

### PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO  
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO  
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &  
PASSIVE RESTRAINT
- (7) OTHER: \_\_\_\_\_
- (9) UNKNOWN

1  
39

### PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY  
EQUIPPED)
- (9) UNKNOWN

2  
40

## EJECTION

### DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0  
43

### AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR  
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: \_\_\_\_\_
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

9 8  
44 45

### IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW:

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

## HEAD RESTRAINT

### HEAD RESTRAINT AVAILABLE FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1  
46

# OCCUPANT INFORMATION OC-3

## OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER \_\_\_\_\_
- (8) NOT APPLICABLE
- (9) UNKNOWN


0  
47

## SOURCE OF INFORMATION

- (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER \_\_\_\_\_
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

0  
48

INDICATE LOCATION OF INJURIES.

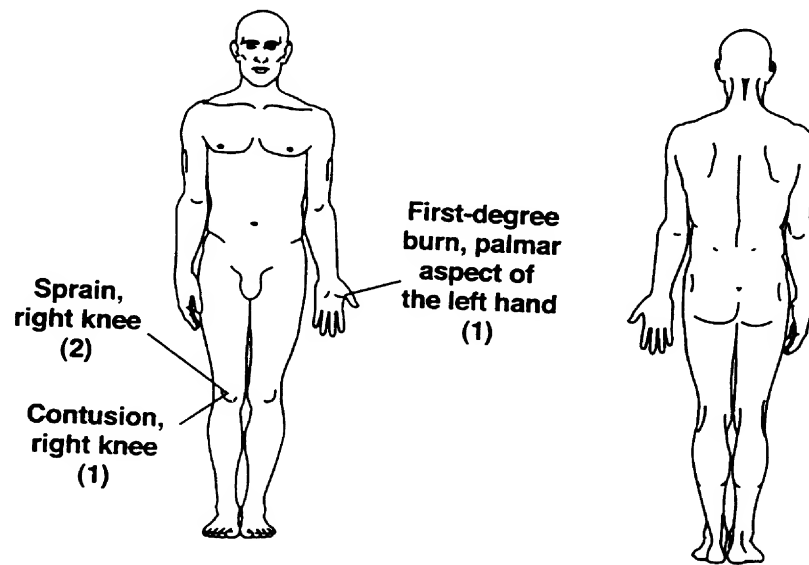

INJURY CLASSIFICATION IC-1

**NOTE:** Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

## OCCUPANT INJURY CLASSIFICATION

[illegible]

**NOTE: USE ADDITIONAL PAGES IF NECESSARY.**

## CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

## FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

## REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

## INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

## SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

## FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

## ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

## EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

## BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

## PENETRATING OBJECTS


- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

## MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (E.G. *FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH",  
HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT



THE FIGURE BELOW  
IS AN EXPLANATION OF THE BODY REGION CODES  
LISTED ON PAGE IC - 4.

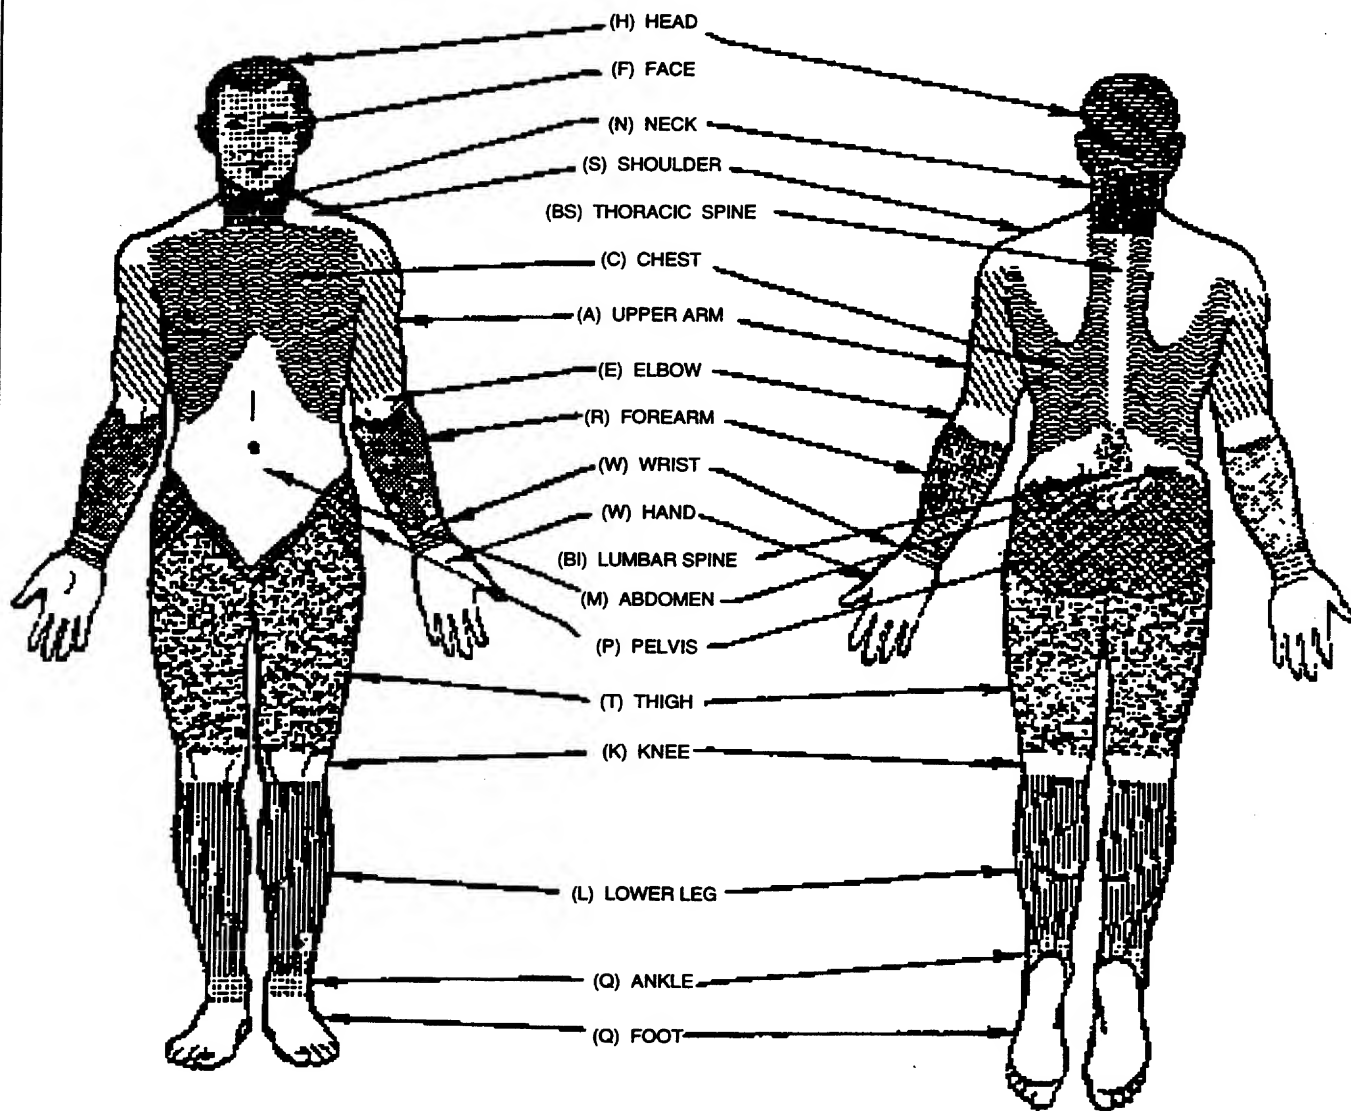

## CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

**1 BODY REGION**

(H) HEAD/SKULL  
 (F) FACE  
 (N) NECK  
 (S) SHOULDER  
 (X) UPPER EXTREMITIES  
 (A) ARM (*UPPER*)  
 (E) ELBOW  
 (R) FOREARM  
 (W) WRIST/HAND  
 (C) CHEST  
 (M) ABDOMEN  
 (B) BACK  
 (P) PELVIC/HIP  
 (Y) LOWER EXTREMITIES  
 (T) THIGH  
 (K) KNEE  
 (L) LEG (*LOWER*)  
 (Q) ANKLE/FOOT  
 (O) WHOLE BODY  
 (U) UNKNOWN

**3 LESION**

(L) LACERATION  
 (C) CONTUSION  
 (A) ABRASION  
 (F) FRACTURE  
 (P) PERFORATION,  
 PUNCTURE  
 (K) CONCUSSION  
 (V) AVULSION  
 (R) RUPTURE  
 (S) SPRAIN  
 (D) DISLOCATION  
 (N) CRUSH  
 (M) AMPUTATION  
 (B) BURN  
 (G) DETACHMENT,  
 SEPARATION  
 (Z) FRACTURE AND  
 DISLOCATION  
 (T) STRAIN  
 (E) TOTAL SEVERANCE,  
 TRANSECTION  
 (O) OTHER  
 (U) UNKNOWN

**4 SYSTEM/ORGAN**

(S) SKELETAL  
 (V) VERTEBRAE  
 (J) JOINTS  
 (D) DIGESTIVE  
 (L) LIVER  
 (N) NERVOUS SYSTEM  
 (B) BRAIN  
 (C) SPINAL CORD  
 (E) EARS  
 (O) EYES  
 (A) ARTERIES  
 (H) HEART  
 (Q) SPLEEN  
 (G) UROGENITAL  
 (K) KIDNEYS  
 (R) RESPIRATORY  
 (P) PULMONARY/LUNGS  
 (M) MUSCLES  
 (T) THYROID, OTHER  
 ENDOCRINE GLAND  
 (I) INTEGUMENTARY (*SKIN*)  
 (W) ALL SYSTEMS IN REGION  
 (U) UNKNOWN

**2 ASPECT**

(R) RIGHT  
 (L) LEFT  
 (B) BILATERAL  
 (C) CENTRAL  
 (A) ANTERIOR/FRONT  
 (P) POSTERIOR/BACK  
 (S) SUPERIOR/UPPER  
 (I) INFERIOR/LOWER  
 (W) WHOLE REGION  
 (U) UNKNOWN

BODY REGION	ASPECT	LESION	SYSTEM/ORGAN	SEVERITY
1	2	3	4	5

**5 SEVERITY**  
(OR "AIS", ABBREVIATED INJURY SCALE)

(0) NONE  
 (1) MINOR  
 (2) MODERATE  
 (3) SERIOUS  
 (4) SEVERE  
 (5) CRITICAL  
 (6) MAXIMUM  
 (9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module 0 C Format 0 2  
9 10 11 12

## OCCUPANT INFORMATION OC-1

<b>OCCUPANT IDENTIFICATION</b>  OCCUPANT NUMBER <u>02</u> 13 14  ROLE OF OCCUPANT AT 1ST IMPACT  (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN <u>2</u> 15		<b>PHYSICAL DESCRIPTION</b>  AGE IN YEARS (00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER (99) UNKNOWN <u>21</u> 20 21  AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN <u>25</u> 22 23  MASS (kg) (999) UNKNOWN <u>170 lb</u> 077 24 25 26  HEIGHT (cm) (999) UNKNOWN <u>5ft, 9in</u> 175 27 28 29  SEX (1) MALE (2) FEMALE (9) UNKNOWN <u>1</u> 30	
<b>OCCUPANT POSITION</b>  ROW LOCATION  (1) FRONT (2) SECOND (3) THIRD (4) FOURTH (7) OTHER: _____ (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN <u>1</u> 16  LATERAL LOCATION  (1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT (9) UNKNOWN <u>5</u> 17  POSTURE  (10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT (50) IN BASSINET (60) IN CHILD SEAT (65) IN CHILD HARNESS (70) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER COMPARTMENT: _____ (85) ON CARGO FLOOR/FOLDED SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT (97) OTHER: _____ (99) UNKNOWN <u>10</u> 18 19		<b>MEDICAL CONDITIONS</b>  TREATMENT/MORTALITY (00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT (05) FATAL, DEAD AT SCENE (06) FATAL, DOA (07) FATAL, DEAD WITHIN 24 HOURS (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD (99) UNKNOWN <u>02</u> 31 32  INJURY SEVERITY SCORE (ISS)  (99) UNKNOWN <u>01</u> 33 34  NON-IMPACT MED. CONDITIONS (0) NONE (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) (6) POST-CRASH NON-FATAL INJURY (7) OTHER: _____ (8) COMBINATION OF ABOVE (CIRCLE EACH) (9) UNKNOWN <u>0</u> 35	

# OCCUPANT INFORMATION OC-2

## MEDICAL CONDITIONS (CONT.)

### POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,  
SEVERITY UNKNOWN
- (9) UNKNOWN

2  
36

## CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE  
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

8 8  
41 42

## CHILD SEAT MAKE/MODEL

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

## RESTRAINT SYSTEM

### ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &  
SHOULDER HARNESS
- (9) UNKNOWN

3  
37

### ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &  
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

0  
38

### PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO  
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO  
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &  
PASSIVE RESTRAINT
- (7) OTHER: *airbag not installed*
- (9) UNKNOWN

1  
39

### PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED *- turned off at switch*
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY  
EQUIPPED)
- (9) UNKNOWN

1  
40

## EJECTION

### DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0  
43

### AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR  
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: \_\_\_\_\_
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

9 8  
44 45

### IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW:

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

## HEAD RESTRAINT

### HEAD RESTRAINT AVAILABLE FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1  
46

# OCCUPANT INFORMATION OC-3

## OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER \_\_\_\_\_
- (8) NOT APPLICABLE
- (9) UNKNOWN

0  
47


## SOURCE OF INFORMATION

- (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER \_\_\_\_\_
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN


0  
48

INDICATE LOCATION OF INJURIES.

Contusion,  
right side  
of forehead  
(1)

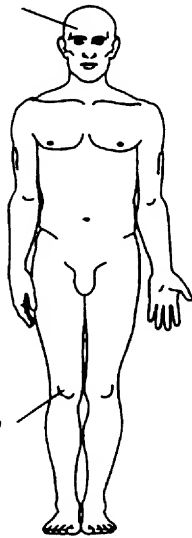

Contusion,  
right knee  
(1)

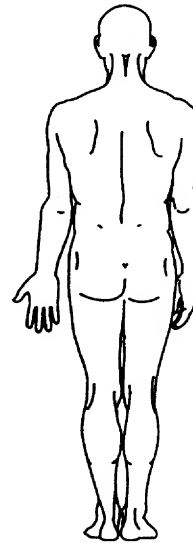

**NOTE:** Each line in the table below is a separate record (card).  
Duplicate columns 1 - 12 for each completed line.

## OCCUPANT INJURY CLASSIFICATION

[illegible]

**NOTE: USE ADDITIONAL PAGES IF NECESSARY.**

## CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

## FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (*X*)
- (55) MIDDLE INSTRUMENT PANEL (*Y*)
- (56) LOWER INSTRUMENT PANEL (*Z*)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

## REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

## INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (AIRBAG)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

## SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

## FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

## Roof

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

## EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

## BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

## PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

## MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (80) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT



Case No. 224-88  
Case No. LA 1988-1004  
Type: Ranger 85.8 cc 2 stroke pickup  
Owner: 37 year old male

Light Conditions: Daylight  
Weather: Clear  
Road Surface: Dry  
Road Conditions: Good



Speed Limit 25 mph (all ages)



60 mm diameter  
tire



PN 22300 #1



PN 22300 #2



PN 22300 #3




PN 22300 #4



PN 22300 # 5  
Best Available



PN 22300 #6

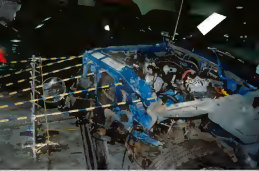

PN 22300 # 7  
Best Available



PN 22300 # 8  
Best Available





PN 22300 #9  
Best Available



PN 22300 #10



**PN 22300 #11**  
**Best Available**



PN 22300 #12




**PN 22300 #13**  
**Best Available**



PN 22300 #14



PN 22300 #15

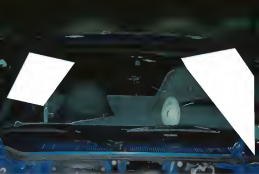

PN 22300 / 16





PN 22300 #17




**PN 22300 #18**  
**Best Available**



**PN 22300 #19**  
**Best Available**



PN 22300 #20  
Best Available

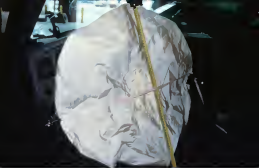


PN 22300 #21  
Best Available



**PN 22300 #22**  
**Best Available**




PN 22300 #23  
Best Available

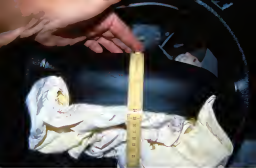

PN 22300 #24  
Best Available



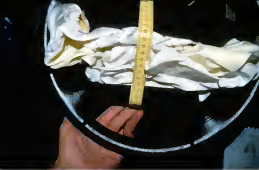

PN 22300 #25  
Best Available



PN 22300 #26  
Best Available



PN 22300 #27  
Best Available



PN 22300 #28



PN 22300 #29



PN 22300 #30



PN 22300-#31



PN 22300 #32





PN 22300 #33



PN 22300 #34



PN 22300 #35



PN 22300 #36



PN 22300 #37



PN 22300 #38



PN 22300 #39



PN 22300 #40





PN 22300 #41



PN 22300 #42



PN 22300 #43



PN 22300 #44



PN 22300 #45



PN 22300 #48



PN 22300 #47



PN 22300 #48





PN 22300 #49



**PN 22300 #50**



PN 22300 #51



PN 22300 #52



PN 22300 #53



PN 22300 #54

PN 22300 2230-00

LAST MEASURE 1989 Ford

TYPE: Ranger XL, 4x4 Super Cab pickup

FAULT: Driver, 27 year-old male

DRIVING: 45 mph S. Hwy. MAJOR: 15 kg roll over

DRIVER'S: 3-point belt just worn. No seat impact  
airbag deployment

DRIVER TYPE: MAJOR: 0      DS: 0

